

LTB00960NAS2



TECHNICAL BULLETIN

05 OCT 2020

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

This bulletin supersedes TSB LTB00960NAS1/2016 dated 01 AUG 2016, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in blue

SECTION:

501-05

SUBJECT/CONCERN:

Loadspace Cover Support Peg(s) Broken

AFFECTED VEHICLE RANGE:

MODEL:

MODEL YEAR:

VIN:

ASSEMBLY PLANT:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover (LG)	2013-2016	001204-290763	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

One or more of the loadspace cover support pegs may be broken, snapped, or loose.

CAUSE:

This may be caused by general wear and tear on the loadspace cover support peg.

ACTION:

Follow the instructions below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
LR092652	Service Repair Kit	1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Loadspace cover - support peg - renew	76.19.14	0.1	42	LR069013

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

1. Open the tailgate.


2.

NOTE:

Make sure the loadspace cover is placed on a clean surface to avoid damage.


Remove the loadspace cover.

3.

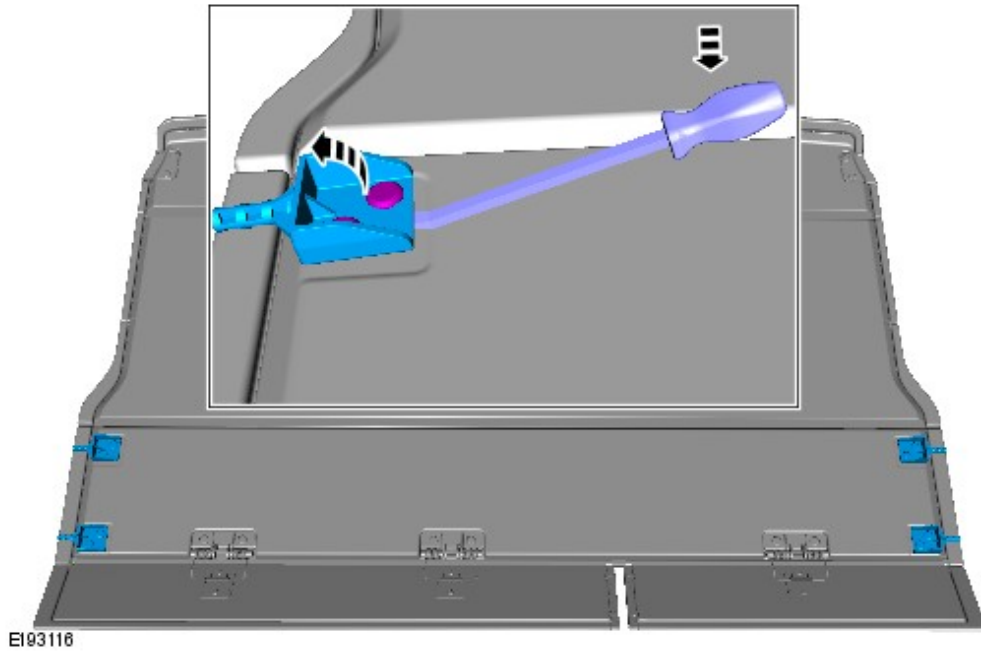

Using a suitable tool, lever off the affected loadspace cover support peg.

4.

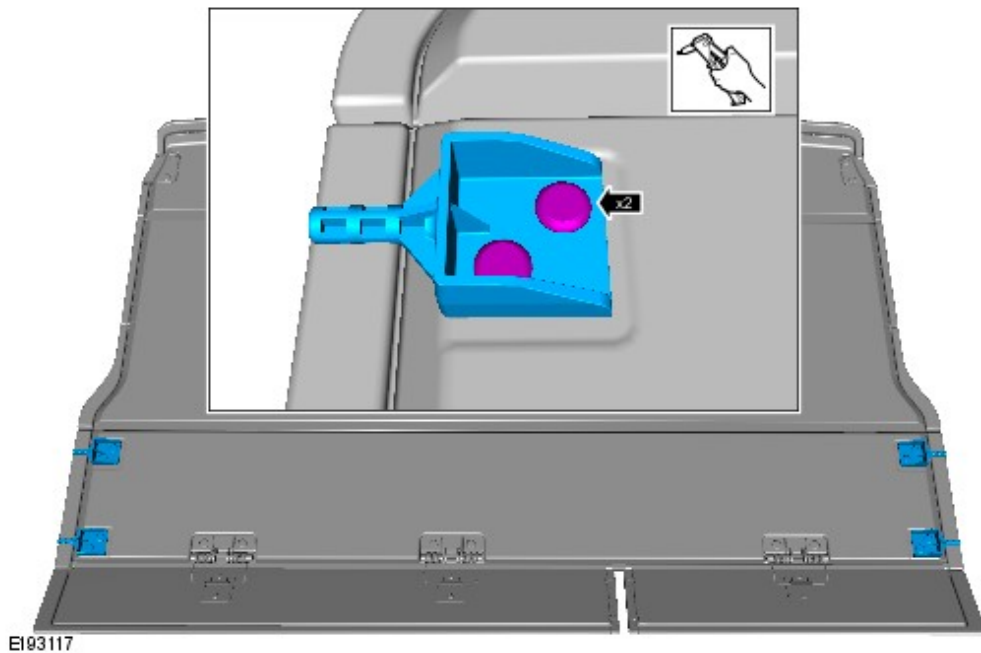

Using a suitable tool, install the new loadspace cover support peg.

- ■ Use the rivets supplied in the Service Repair kit.

5. Repeat Steps 3 and 4 for all broken, snapped, or loose loadspace cover support pegs.

6. Install the loadspace cover.

7. Close the tailgate.