

QUARANTINE NOTICE

| | | |
|-------------------|--|--|
| Reference number: | QN-63-1424 | Issued: 12 October, 2020 |
| Subject: | Update the Body Controller Front Software | |
| Model(s): | DBX | |
| VIN Range: | Refer to the separately published list of affected Vehicle Identification Numbers (VINs) | |
| Applicable to: | All | |
| Distribute to: | After Sales Manager Executive Manager Service Manager Sales Manager | Warranty Staff Technician(s) Parts Staff |

Reason for this Quarantine Notice

Aston Martin has found that some vehicles have a software issue where the vehicle may not give a reminder for the side lamps/parking lamps.

Do the workshop procedure that follows to update the Body Controller Front (BC_F23) module to correct this problem.

Workshop Procedure

CAUTIONS: CONNECT THE AMDS 2.0 EQUIPMENT TO AN ELECTRICAL SUPPLY WHEN YOU DO THE PROCEDURE THAT FOLLOWS. IF THE LAPTOP BATTERY VOLTAGE DECREASES DURING THE SOFTWARE UPDATE, THE UPDATE CAN FAIL AND CAN CAUSE DAMAGE TO THE MODULE.

YOU MUST CONNECT A BATTERY CHARGER TO THE VEHICLE BEFORE YOU DO DIAGNOSTIC PROCEDURES. IF THE VEHICLE BATTERY VOLTAGE DECREASES DURING THE PROCEDURE, THE SOFTWARE UPDATE CAN FAIL AND CAN CAUSE DAMAGE TO THE MODULE.

Notes: *Make sure that the AMDS 2.0 software has updated to the latest version. The AMDS 2.0 software will need a good Internet connection (minimum broadband speed of 2 Mbit/second) to make sure that the software is updated correctly.*

A high output battery charger (minimum of 80 A) is necessary to meet the demand of the radiator cooling fan. The battery charger must also be compatible with Absorbent Glass Mat (AGM) type batteries.

1. Set the ignition to ON but do not start the engine.
2. Connect the Vehicle Communication Interface (VCI) to the vehicle by using the Diagnostic Link Cable (DLC).
3. Start the AMDS 2.0 software and, if necessary, update to the latest version.

- 4. Select 'ECU Coding'. (Refer to Figure 1).

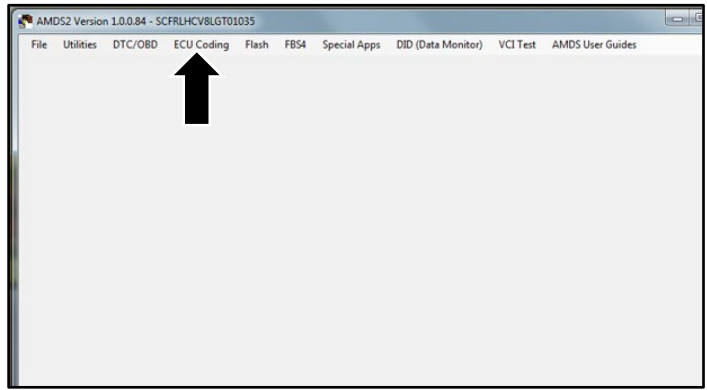


Figure 1

- 5. Select the "BC_F23" module then click the "OK" button (refer to Figure 2).

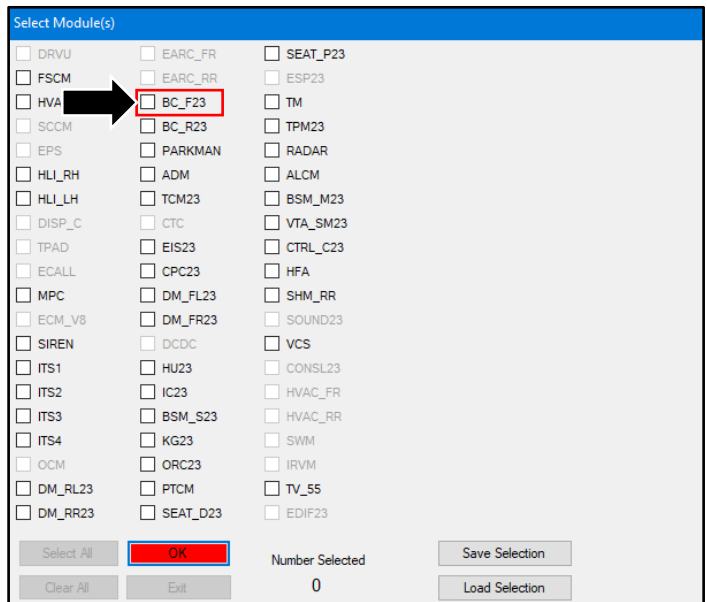


Figure 2

- 6. Select "Get coding from AML Server" (refer to Figure 3).

Coding will appear in the main display.

Note: Make sure the correct VIN is shown.

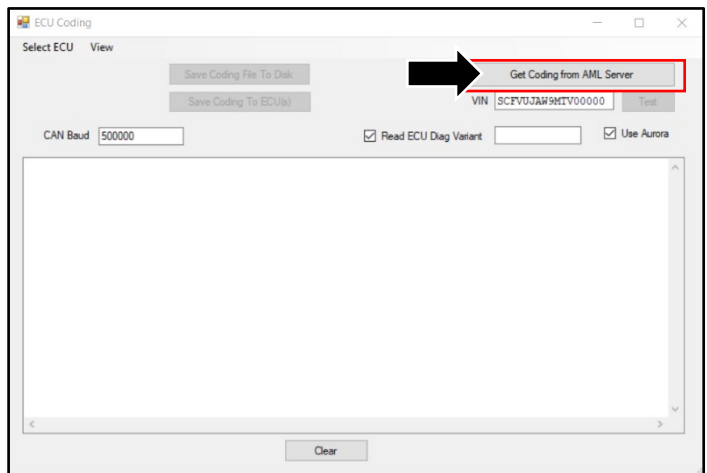


Figure 3

7. Select “Save Coding To ECU(s)” (refer to Figure 4).

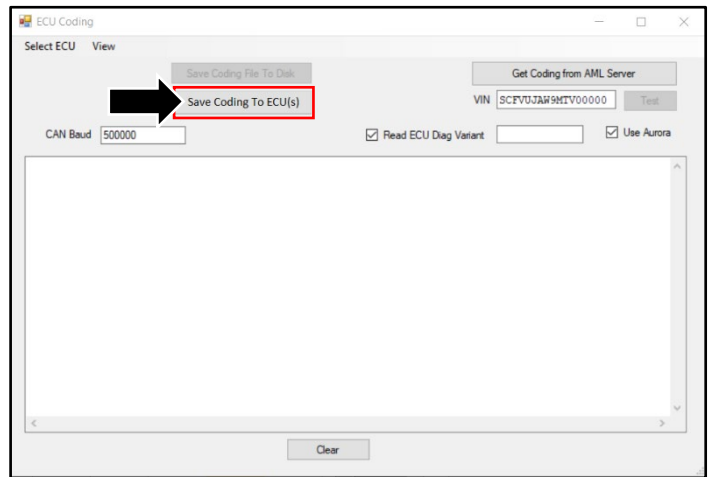


Figure 4

8. Click the “DTC/OBD” button (refer to Figure 5).

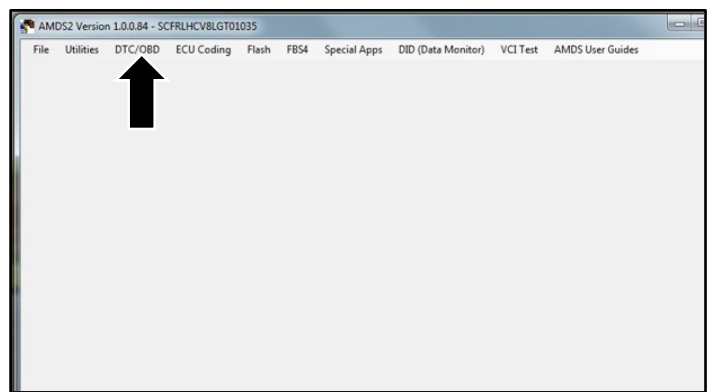


Figure 5

9. In the “DTC Read” window, click the ‘Read DTC’ button, (refer to Figure 6).

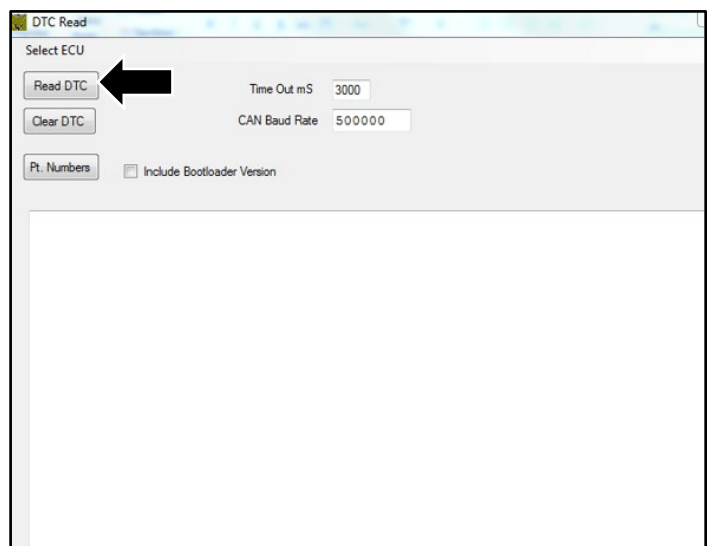


Figure 6

10. Make sure there are no diagnostic trouble codes (DTCs) stored for the BC_F23 module.
11. Set the ignition to OFF.
12. Open the door to make sure the ignition turns off, then close the door again.
13. Set the ignition to on but do not start the engine.
14. Do a check for DTCs.

15. Disconnect the VCI from the vehicle and shut down AMDS 2.0.
16. Set the ignition to Off.

Warranty Data

Procedure and Labour Time

| Description | Labour Time |
|----------------------------|-------------|
| Update the BC_F23 Software | 0.2 hours |

If you have any questions related to this document, please refer to the 'Contact Us' link on this webpage, or contact your local Dealer or After Sales Manager.

The English version of this document is written in Simplified Technical English to ASD-STE100™.