



## Preliminary Information

### PIT5785 Night Vision Inoperative Green Pixelated / Fuzzy Screen

Product Investigation Review Required

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT5	2020 - 2021	All	All	All	All
Cadillac	XT6	2020 - 2021	All	All	All	All

<b>Involved Region or Country</b>	<b>North America</b>
<b>Condition</b>	Night Vision is inoperative, will have a green pixelated picture in the DIC.
<b>Cause</b>	The LVDS /USB Black connector is not connected to the cluster or has a poor connection.

#### **Correction:**

There are 2 LVDS /USB connectors on the back of the cluster.


One is gray and the other is black.


The gray connector is an output going to the HUD.

The black connector is the input from the Night Vision Camera Control Module.

Inspect the back of the cluster to see that the black LVDS /USB connector is seated correctly .

If the connector is missing, inspect around the cluster ip harness to find it and install it.

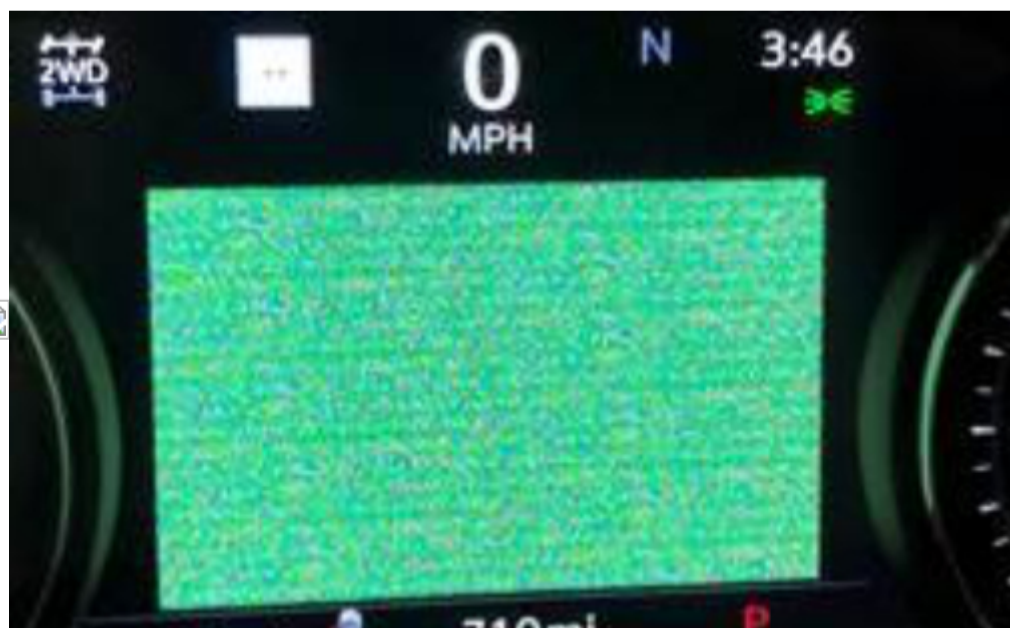

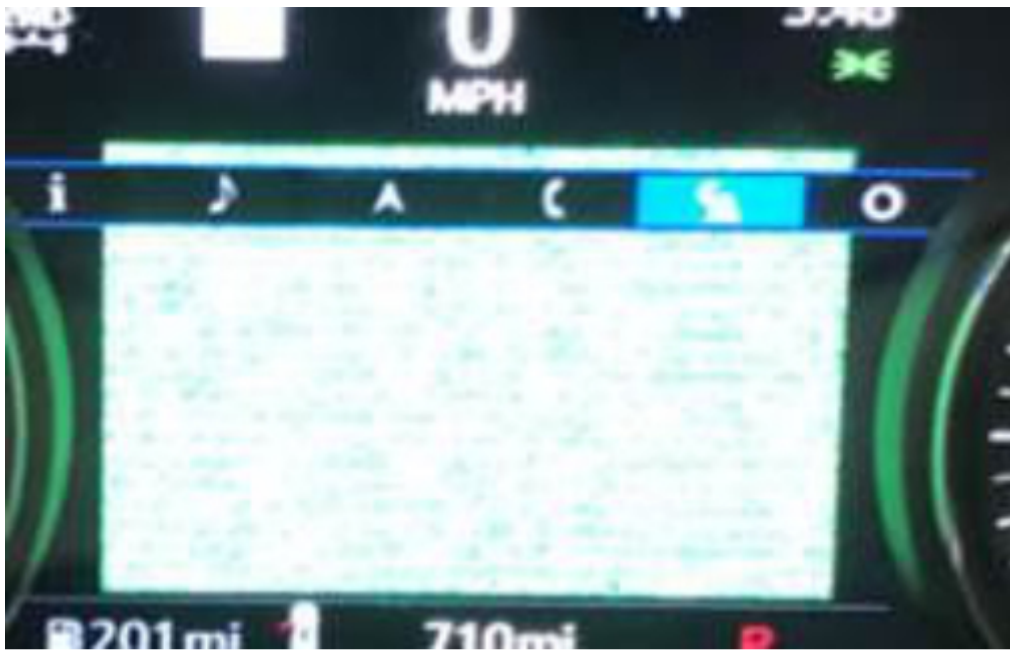

### Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

### Version History

Version	1
Modified	10/07/2020 - Created



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.