

Published date: 10/12/2020

Preliminary Information

PIC6293E Installation Of the GM Accessory Interior Spectrum Lighting Kit

<u>Models</u>

Brand:	Model:	Model Years:	VIN:		Enginer	Transmissions	
			from	to	Engine:	Transmissions:	
Chevrolet	Camaro	2016 - 2021	All	All	All	All	
Involved Region or Country North America							
Chevrolet Camaro 2016-2021 All All All All Involved Region or Country North America Condition Some technicians may comment that after the GM Accessory Interior Spectrum Lighting Kit (commonly referred to as the Interior Ambient Lighting Kit or the Interior Accent Lighting Kit) the lighting is inoperative. The purpose of this Preliminary Information is to provide dealership technicians some tips on installation of this kit, as well as some common areas to check if the system is inoperative after installation is completed. The Interior Spectrum Lighting kit is a GM Accessory kit that allows color changing lighting to be installed inside the vehicle. The system is capable of producing 24 different colors. There are three different types of Lighting kits listed below that may be installed in the 6th generation (2016+) Camaros so it is very important to know which kit is being installed. 1) Light up Accent Lighting on the door panels only Optimination of the door panels only						the Interior Ambient he lighting is ormation is to provide of this kit, as well as operative after sory kit that allows vehicle. The system e are three different ostalled in the 6th ant to know which kit	



2) Footwell Lighting only



3) Light up Accent Lighting on the door panels AND Footwell Lighting

IMPORTANT: When installing a GM Accessory Lighting Kit, the light strips around the radio display and the center cupholders will NOT illuminate. The only way to get these two lights to operate is to purchase the vehicle with the factory C70 RPO. The radio display and the center cupholder will NOT illuminate with installation of the GM Accessory Lighting Kit.



Installation Tips:

The first thing that needs to be done when installing any GM Accessory kit, is to have the Parts Department contact Partech, obtain a case number, and verify that the kit being installed is the correct one for the VIN in question. Many kits looks similar, but are only intended for specific options or RPOs. If the incorrect kit is installed on a vehicle, it will result in much frustration and wasted time by the technician.

Along with each of the three types of Light Kits, each kit comes in several different trim colors as well. These are currently available in

silver, black, and red. In addition to that, which kit is needed depends on the radio that the vehicle is equipped with. As you can see, obtaining the correct kit PN is crucial for a smooth, trouble-free installation.

Once the correct kit has been verified through Partech, determine which of the three types of Lighting Kits you will be installing. Then, refer to SI and read through the instructions. These are broken up in sections based on which kit is being installed.


IMPORTANT: NOTE- Be sure that the correct section of the installation instructions is being followed for the type of kit that is being installed.

One question that consistently comes up during the installation of this kit, is regarding steps 25-31. On many vehicles, it may be noted that there are already wires present in the side body-to-door connectors (X500 or X600) in cavities 42 and 43. This is not a mistake or a misbuild. These wires have been inserted in these cavities on purpose. To complete the installation of this GM Accessory kit, simply remove these two existing circuits from the connector in question, tape them up, and secure them out of the way. Then, continue installing the wires from the Accessory kit as directed.


Troubleshooting Tips:

If the Lighting Kit is inoperative upon installation, the following items should be inspected:

 If the entire kit has been installed and the lighting is entirely inoperative, there are a few things to go back and check. The most common area for concern is G202, which is located at the right hand kick panel. Typically, this ground has paint on it when the kit's eyelet is installed. Just tightening the fastener does not provide a good ground path if there is still paint covering the sheet metal. The fastener will have to be removed, the paint needs to be cleaned or ground off, and the ground path verified.

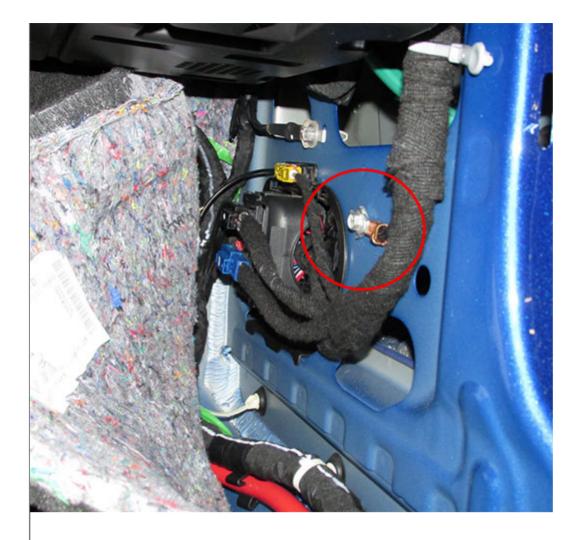


- There are 3 circuits that are spliced or plugged into the BCM related wiring. One of the circuits in the kit has a blunt cut end and must be tapped into the dash wiring going to the BCM. The two other wires have terminals crimped on the end and they are supposed to be inserted into empty BCM connector cavities. A common installation error is to install either of these circuits into the incorrect connector cavity. Either one of these terminals can easily be installed accidentally into an adjacent BCM connector cavity.
- Another common issue that is seen relates to the Posi-Tap connectors used in the kit. These connectors are used to splice the accessory harness to the vehicle's wiring harness. Dealership technicians are to go back through the installation and verify that each connector is tight. If one or more of these connecters is/are loose, this will cause any number of performance issues with the kit. The connector shown in the photo below does not have tape or a zip tie covering it for clarity. Once the connector is properly installed, the instructions have the technician tape back the splice to the main harness using cloth tape. This will prevent the connector from loosening up over time.

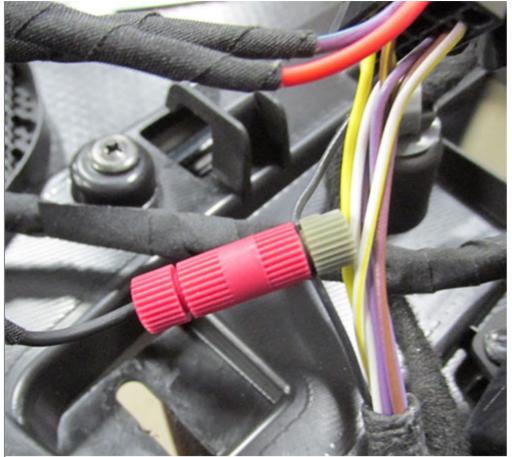

If the vehicle is equipped with an "uplevel" radio (RPOs IO5, IO6, IOS, or IOT) various modules will require reprogramming through Techline. This programming allows the customer to select the various lighting colors on the radio's touchscreen, as seen in the color palette photo below. As seen in the second photo below, there will also be a sheet of paper included in the kit that has an authorization code printed on it. Once that code is provided to Techline, they will be able to assist in correctly programming the vehicle.

For the 2016 - 2018 models with the IO5 or IO6 radio, the HMI and the BCM will require SPS programming.

For the 2019+ models with the IOS or IOT radio, the radio and BCM will require SPS programming.

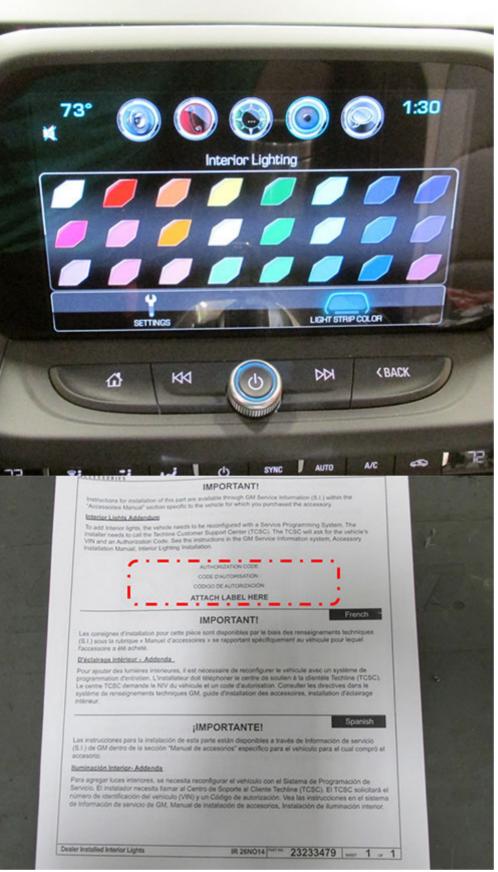

 Vehicles equipped with the base radio (RPO IOB or IOR) do not require any programming. That is why the color selections are not available on the radio screen. This system uses a dashmounted switch to change the system's lighting colors. It is installed on the left hand side of the steering column. This switch can be seen in the photo below.



Version History

Version	6
	07/18/2017 - Created on
	11/26/2018 - Updated Model Years
	12/18/2018 - Updated Condition
Modified	05/15/2019 - Updated Condition
	03/03/2020 - Updated Model Year
	10/12/2020-Updated Model Year



© 2020 General Motors. All Rights Reserved.