



# Preliminary Information

## PIP5757 Service Engine Soon Light/Message with DTCs P1967 or P1968 in the TCM

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Corvette	2020	All	All	All	M1L

Involved Region or Country	North America
Condition	Service engine tell-tale or message with stored TCM DTCs or P1967 and or P1968
Cause	TCM Software anomaly

Some customers may comment on a service engine telltale, reduced engine power message with no noticeable performance issues. When scanning the vehicle for DTCs the technician may find P0700 stored in the ECM and P1967, P1968 stored in the TCM. If there are other DTC in the TCM diagnose those first as per service information.

If only DTCs P1967 or P1968 are set, then do not request a TCM replacement per latest version of [PIP5703](#). Please perform the even and odd related clean procedures in GDS, perform a service fast learn also in GDS and reevaluate. Currently software is being developed to correct this concern as it is not a performance issue with the TCM or transmission assembly but a software anomaly.

This PI will be updated when software is available.

### Version History

Version	1
Modified	10/12/2020 - Created on.

