



VST Operation Number

VST Operation Number	Description
98494-2	Screw engine pad replace acc. to TJ33442

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

*Structure week updated. Example of Lubricant added. When writing a report add video and sound file.

If the vehicle has a click sound from the left engine pad during driving, (a metallic click sound from A-pillar area)

Sound file with clicking noise added. (For best sound, use headphones)

Follow the advice under "Service".

SERVICE:

Separate the engine pad and lubricate with graphite (see attachment), then follow instruction new screw and washer.

Torque 10 NM.

* Example of Lubricant to use Wurth P/N 0893240016.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if click sound returns after repair * and add video and sound file.

Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 2180.

To view TJ attachment continue to the next page. This TJ has three attachments.

SPA – Left engine pad click sound



Put lubricating grease with graphite on red marked points as in pictures above.

TJ33442

