

---

PuMA measure

## RR31 - Rear Bumper, Chrome / Dark Chrome finisher trim insecure or detached

UR-V-2 65080066-06 - 10/29/20

### Complaint:

The rear bumper upper chrome / dark chrome finisher trim has become detached or has excess movement at one or both ends.

---

### Cause

Excess tension is placed on the clip, causing the adhesion between clip and trim to separate.

---

### Measure

If a defect of the trim has been found, please replace the component.

Part numbers affected:

Silver Badge - Chrome - 51 12 7448723

Black Badge - Dark Chrome - 51 12 8737664

When replacing the chrome finisher trim, follow these steps using the attached guide:  
The installation is identical for silver and black badge vehicles.

1. Inspect the new trim and confirm 1 or 2 green star stickers are attached = Part OK.
2. Remove failed chrome finisher trim from the vehicle.
3. Leave felt tape applied to bumper.
4. Remove tape if it is applied to the replacement trim.
5. Install new chrome finisher trim, starting from the centre clip, working outwards.

Please do not attempt to repair and re-install a trim that has failed.

---

### Validity information

Model series:	[RR31]
Engine range:	[ALL]
Body style:	[ALL]
Fault codes:	[]
Production period:	-

---

### Repair overviews

51/12/001/27483/30049, Bumper panel, rear, 2-part, bottom, strip, Cannot be encoded with VFC, , Cannot be encoded with VFC, ,  
Checking, repairing, replacing

---

## Attachments

---

Number of attachments: 3