



# Service Bulletin

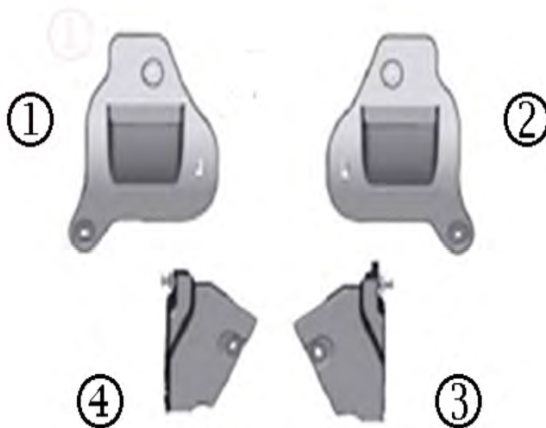
Bulletin No.: 19-NA-030

Date: October, 2020

## INFORMATION

**Subject:** Information on High Power Steering Temperature During Track Use, Loss of Power Steering Assist, and/or Steering Effort Reduced Message in Driver Information Center (DIC)

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro ZL1	2017	2021	—	—	—	—
	Camaro ZL1-1LE (RPO A1Z)	2018	2021				

<b>Involved Region or Country</b>	North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Japan, GM Korea Company, China, Taiwan, Philippines
<b>Condition</b>	Some customers may comment on a loss of power steering assist and a Steering Effort Reduced message displayed on the DIC. This occurs during track events in extreme heat.
<b>Cause</b>	This may be caused by reduced air flow around the power steering gear during extreme track temperatures.
<b>Correction</b>	<p><b>Install Power Steering Deflectors for track use only. Follow the installation instructions included with the deflector kit.</b></p> <p>The contents of the deflector kit are shown in the graphic below: Right (1) and left (2) Deflectors, and left (3) and right (4) Shield Supports.</p> 

5226118

**Important:**

- Keep the two side shields and side shield screws so the side shields can be reinstalled after track use. The remaining fasteners will be used to attach the deflectors and shield retainers.
- Before driving on public roads, the deflectors should be removed and the original shields should be reinstalled.
- Installation time is approximately 10 minutes with the vehicle on a hoist.

**Graphic with Power Steering Deflectors Installed**

5249064

**Parts Information**

Description	Part Number	Qty
Deflector Package – Front Compartment Air	84669205	1

<b>Version</b>	2
<b>Modified</b>	Released February 14, 2019 October 12, 2020 – Added 2020-2021 Model Years and updated the Involved Region or Country section.