

WLA5 - Replacing Rear Axle Differential (Workshop campaign)

Vehicle type: **Cayenne (9YAAE1)/Cayenne S (9YAAM1)/Cayenne Turbo (9YACF1)**

Model Year: **2019**

Subject: **Rear axle differential**

Information: Due to inadequate cleaning of the rear axle differential components during the production process, there is a possibility that production residues may have been left in the rear axle differential.

These production residues can damage the splines or the bearings in the rear axle differential over the service life of the vehicle.

Remedial Action: Replace rear axle differential.



Information

Due to various equipment variants, the required preparatory and concluding work for removing and installing the rear axle differential can differ depending on the vehicle. Specific campaign scopes have been defined for this purpose.


Every vehicle is therefore **assigned just one campaign scope**.

To find out which campaign scope is assigned to each vehicle, see PCSS Vehicle Information.

For an overview of the campaign scopes, see *⇒ Technical Information 'Warranty processing'*.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information). This campaign affects 25 vehicles.

Installation
Position:

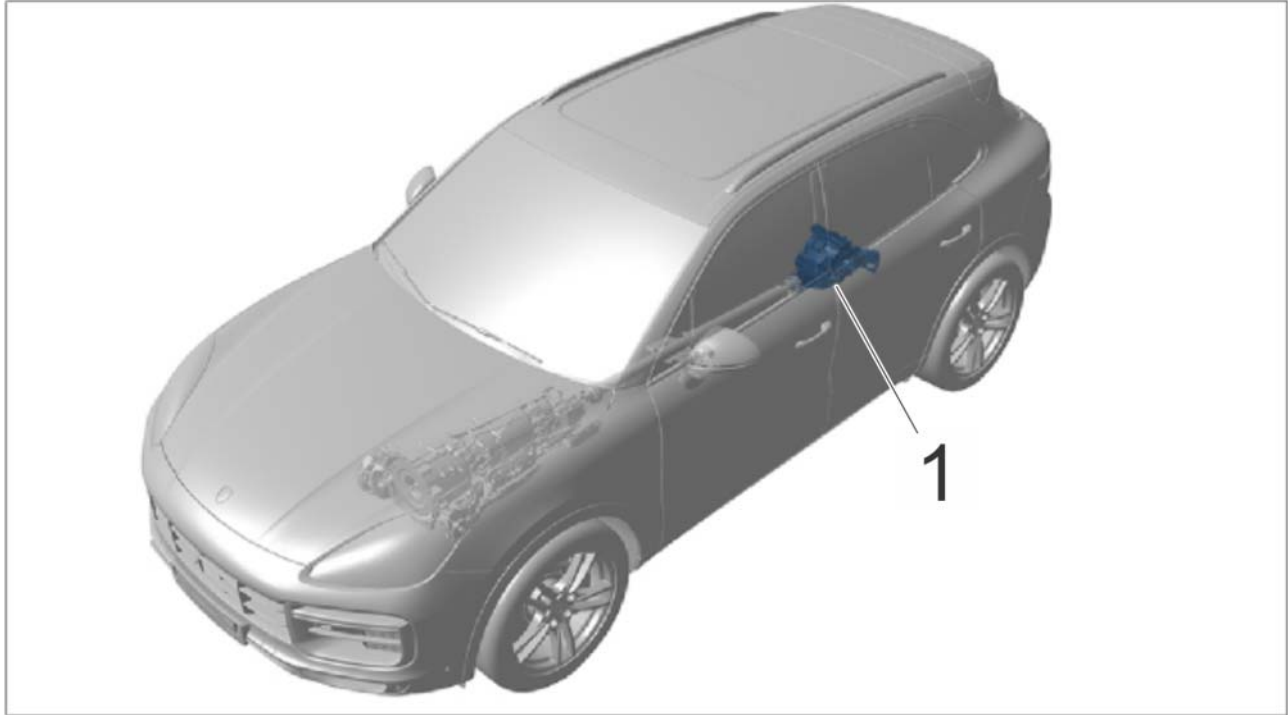

Installation position of rear axle differential

1 – Rear axle differential (**replace**)

Parts required

Parts Info:	Part No.	Designation – Use	Qty.
	ODG500043HX	⇒ Rear axle differential	1 ea.
	PAF107599	⇒ Cheese head bolt, M10 x 1 x 45 – Cardan shaft to rear axle differential	6 ea.
	95534919121	⇒ Plate – Cardan shaft	3 ea.
	PAF91201301	⇒ Combination screw, M14 x 1.5 x 120 – Rear axle differential to rear axle housing, front	1 ea.
	PAF91114701	⇒ Combination screw, M12 x 1.5 x 110 – Rear axle differential to rear axle housing, rear	2 ea.
	N 91228001	⇒ Hexagon-head bolt M14 x 1.5 x 145 – Rear axle housing to body	2 ea.

N 10629602	⇒ Hexagon-head bolt, M10 x 35 – Rear strut to body	2 ea.
8E0407643A	⇒ Collared cheese head bolt, M16 x 1.5 x 72 – Drive shaft to wheel hub	2 ea.
95533212500	⇒ Circlip – Drive shaft to wheel hub	2 ea.
N 10810701	⇒ Hexagon-head bolt, M8 x 25 – Anti-roll bar to rear axle housing	2 ea.
N 91228901	⇒ Hexagon-head bolt, M10 x 70 – Connecting link to anti-roll bar	2 ea.
N 10272302	⇒ Hexagon-head bolt, M10 x 35 – Connecting link to anti-roll bar	2 ea.
958007096	⇒ Hexagon-head bolt, M12 x 1.5 x 100 – Longitudinal control arm to wheel bearing housing	2 ea.
N 10106403	⇒ Hexagon nut, M14 x 1.5 – Upper control arm, front to wheel bearing housing	2 ea.
N 91237101	⇒ Hexagon-head bolt, M14 x 1.5 x 85 – Upper control arm, front to wheel bearing housing	2 ea.
PAF006496	⇒ Hexagon-head bolt, M14 x 1.5 x 100 – Upper control arm, rear to wheel bearing housing	4 ea.
N 10629602	⇒ Hex flange bolt, M10 x 35 – Rear strut to body	2 ea.
N 10699401	⇒ Hexagon-head bolt, M10 x 50 – Rear strut to body	2 ea.
N 10456004	⇒ Internal hexagon round countersunk screw, M6 x 12 – Brake disc to wheel hub	4 ea.

Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):

WHT004571	⇒ Collared cheese head bolt, M14 x 1.5 x 115 – Brake calliper to wheel bearing housing	4 ea.
-----------	---	-------

or

Also for vehicles with PSCB (I-no. 1ZI):

N 91183701	⇒ Collared cheese head bolt, M14 x 1.5 x 135 – Brake calliper to wheel bearing housing	4 ea.
------------	---	-------

or

Also for vehicles with PCCB (I-no. 1ZV):

N 91252201	⇒ Collared cheese head bolt, M14 x 1.5 x 130 – Brake calliper to wheel bearing housing	4 ea.
------------	---	-------

Required tools

Tools:

- Torque wrench, 2-10 Nm (1.5-7.5 ftlb.), e.g. **VAG 1783 Torque wrench, 2-10 Nm (1.5-7.5 ftlb.)**
- Torque wrench, 6-50 Nm (4.5-37 ftlb.), e.g. **VAG 1331A Torque wrench, 6-50 Nm (4.5-37 ftlb.)**
- Torque wrench, 20-100 Nm (15-74 ftlb.), e.g. **VAS 5820 Torque wrench, 20-100 Nm (15-74 ftlb.)**
- Torque/torque angle wrench, 20-400 Nm (15-296 ftlb.), e.g. **VAS 6942 Digital torque wrench, 20-400 Nm (15-296 ftlb.)**
- Torque wrench, 40-200 Nm (30-148 ftlb.), e.g. **VAG 1332 Torque wrench, 40-200 Nm (30-148 ftlb.)**
- **VAS 6832 Master Gear unit elevating platform**
- **T40093/3P - Support**
- **T40091/50-51 - Support**
- **T10439 - Assembly pin**
- **9472 - Brake piston resetting fixture**
- **VAS 6926 Puller set**
- **T10187 - Press-out tool**
- **VW552 - Spring compressor**
- **VAS 6931 Transmission and Engine Jack**
- **9799 - Impact puller**
- **VAS 741 039 Manoeuvring aid set**
- **9825/3 - Adapter**
- **9825/1 - Connecting line**
- **VAS 6629A Nitrogen Filler Set for Air-Spring Struts**
- **VAS 6826 Steering wheel balance**
- **VAS 6918 Quick-Clamping Unit**
- **9229/1 - Puller hook**
- **T10188 - Open-end spanner insert**
- **VAS 6883 Insulated Tool Set**
- **VAS 6890 Spring Band Clamp Pliers**
- **VAG 1275A Hose clip pliers**
- **VAS 6918 Quick-Clamping Unit**
- **T40183 - Open-end spanner insert**
- **VAS 6826 Steering wheel balance**
- **VAS 6927 Tie-wrap pliers**
- **VAS 6430/1A Setting Device with Reflector**
- **VAS 6430/3 ACC reflector mirror**
- **VAS 6430/4 Lane Departure Warning Calibration Plate**
- **VAS 6430/6 Enhanced night vision calibration unit**
- **VAS 6350A Calibration unit**
- **VAS 6350/2A Spacing laser**
- **9900 - PIWIS Tester 3**
- Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 Battery charger 90A**

**Information**

The Cayenne is equipped as standard with a **lithium starter battery**, which must only be charged using suitable battery chargers.

For further information about the battery chargers to be used, see:

- ⇒ *Workshop Manual '27061N General information on the 12-volt lithium-ion battery'*
- ⇒ *Workshop Manual '270689 Charging vehicle electrical system battery'*

Replacing rear axle differential**Information**

Read and follow the preparatory and concluding work for removing and installing the rear axle differential described in the model-specific Workshop Manual.

Also note that the required subsequent work for calibrating the assistance systems listed below can vary depending on equipment variant:

- ACC/Distance measuring sensor control unit (8T3, 8T8, 3V1, 3V2)
- Front camera (QK8)
- Infrared camera (9R1)

- Remedial action:
- 1 Raise the vehicle on a lifting platform ⇒ *Workshop Manual '4X001N Lifting the vehicle'*.
 - 2 Remove wheels on the rear axle ⇒ *Workshop Manual '440519 Removing and installing wheel'*.
 - 3 Replace rear axle differential.
For instructions, see ⇒ *Workshop Manual '390119 Removing and installing final drive'*.
 - 4 Install wheels on the rear axle ⇒ *Workshop Manual '440519 Removing and installing wheel'*.
 - 5 Lower the vehicle and remove it from the lifting platform ⇒ *Workshop Manual '4X001N Lifting the vehicle'*.
 - 6 Enter the campaign in the Warranty and Maintenance booklet.

Warranty processing**Information**

The specified working times were determined specifically for carrying out this campaign and include all required preliminary and subsequent work.

The working times may differ from the working times published in the Labor Operation List in PCSS.

Scope 1:

Only relevant for vehicles with the following **version/equipment**:

- Air suspension (1BK)

Working time:

Replacing rear axle differential

Labor time: **1176 TU**

Includes:

Raising and lowering the vehicle

Removing and installing wheels on the rear axle

Removing and installing rear cardan shaft

Performing suspension alignment at front and rear and making adjustments

Calibrating front camera

Checking and adjusting steering-angle sensor for PSM

Parts required:

ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.
PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.

PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.
Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):		
WHT004571	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PSCB (I-no. 1ZI):		
N 91183701	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PCCB (I-no. 1ZV):		
N 91252201	Collared cheese head bolt, M14	4 ea.
⇒ Damage Code WLA5 066 000 2		

Scope 2:

Only relevant for vehicles with the following **version/equipment**:

- Air suspension (1BK)
- ACC/Distance measuring sensor control unit (8T3, 8T8, 3V1, 3V2)

Working time:		
Replacing rear axle differential		Labor time: 1220 TU
Includes:		
Raising and lowering the vehicle		
Removing and installing wheels on the rear axle		
Removing and installing rear cardan shaft		
Performing suspension alignment at front and rear and making adjustments		
Calibrating front camera		
Checking and adjusting steering-angle sensor for PSM		
Parts required:		
ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.
PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.

N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.
Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):		
WHT004571	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PSCB (I-no. 1ZI):		
N 91183701	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PCCB (I-no. 1ZV):		
N 91252201	Collared cheese head bolt, M14	4 ea.
⇒ Damage Code WLA5 066 000 2		

Scope 3: **Only relevant** for vehicles with the following **version/equipment**:

- Air suspension (1BK)
- Night View Assist (9R1)

Working time:

Replacing rear axle differential

Labor time: **1236 TU**

Includes:

- Raising and lowering the vehicle
- Removing and installing wheels on the rear axle
- Removing and installing rear cardan shaft
- Performing suspension alignment at front and rear and making adjustments
- Calibrating front camera
- Checking and adjusting steering-angle sensor for PSM

Parts required:

ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.
PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.

Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):

WHT004571	Collared cheese head bolt, M14	4 ea.
-----------	--------------------------------	-------

or

Also for vehicles with PSCB (I-no. 1ZI):

N 91183701	Collared cheese head bolt, M14	4 ea.
------------	--------------------------------	-------

or

Also for vehicles with PCCB (I-no. 1ZV):

N 91252201	Collared cheese head bolt, M14	4 ea.
------------	--------------------------------	-------

⇒ **Damage Code WLA5 066 000 2**Scope 4: **Only relevant** for vehicles with the following **version/equipment**:

- Air suspension (1BK)
- Porsche Dynamic Chassis Control – PDCC (1P7)

Working time:

Replacing rear axle differential

Labor time: **1278 TU**

Includes:

Raising and lowering the vehicle

Removing and installing wheels on the rear axle

Removing and installing rear cardan shaft

Performing suspension alignment at front and rear and making adjustments

Calibrating front camera

Checking and adjusting steering-angle sensor for PSM

Parts required:

ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.
PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.

N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.
Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):		
WHT004571	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PSCB (I-no. 1ZI):		
N 91183701	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PCCB (I-no. 1ZV):		
N 91252201	Collared cheese head bolt, M14	4 ea.
⇒ Damage Code WLA5 066 000 2		

Scope 5:

Only relevant for vehicles with the following **version/equipment**:

- Air suspension (1BK)
- Porsche Dynamic Chassis Control – PDCC (1P7)
- ACC/Distance measuring sensor control unit (8T3, 8T8, 3V1, 3V2)

Working time:		
Replacing rear axle differential		Labor time: 1306 TU
Includes:		
Raising and lowering the vehicle		
Removing and installing wheels on the rear axle		
Removing and installing rear cardan shaft		
Performing suspension alignment at front and rear and making adjustments		
Calibrating front camera		
Checking and adjusting steering-angle sensor for PSM		
Parts required:		
ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.

PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.
Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):		
WHT004571	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PSCB (I-no. 1ZI):		
N 91183701	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PCCB (I-no. 1ZV):		
N 91252201	Collared cheese head bolt, M14	4 ea.
⇒ Damage Code WLA5 066 000 2		

Scope 6: **Only relevant** for vehicles with the following **version/equipment**:

- Air suspension (1BK)
- Porsche Dynamic Chassis Control – PDCC (1P7)
- ACC/Distance measuring sensor control unit (8T3, 8T8, 3V1, 3V2)
- Night View Assist (9R1)

Working time:

Replacing rear axle differential

Labor time: **1317 TU**

Includes:

- Raising and lowering the vehicle
- Removing and installing wheels on the rear axle
- Removing and installing rear cardan shaft
- Performing suspension alignment at front and rear and making adjustments
- Calibrating front camera
- Checking and adjusting steering-angle sensor for PSM

Parts required:

ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.
PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.

Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):

WHT004571	Collared cheese head bolt, M14	4 ea.
-----------	--------------------------------	-------

or

Also for vehicles with PSCB (I-no. 1ZI):

N 91183701	Collared cheese head bolt, M14	4 ea.
------------	--------------------------------	-------

or

Also for vehicles with PCCB (I-no. 1ZV):

N 91252201	Collared cheese head bolt, M14	4 ea.
------------	--------------------------------	-------

⇒ **Damage Code WLA5 066 000 2**

Scope 7:

Only relevant for vehicles with the following **version/equipment**:

- Steel springs (1BH)

Working time:

Replacing rear axle differential

Labor time: **1058 TU**

Includes:

Raising and lowering the vehicle

Removing and installing wheels on the rear axle

Removing and installing rear cardan shaft

Performing suspension alignment at front and rear and making adjustments

Calibrating front camera

Checking and adjusting steering-angle sensor for PSM

Parts required:

ODG500043HX	Rear axle differential	1 ea.
PAF107599	Cheese head bolt, M10	6 ea.
95534919121	Plate, M10	3 ea.
PAF91201301	Combination screw, M14	1 ea.
PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.

N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.
Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):		
WHT004571	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PSCB (I-no. 1ZI):		
N 91183701	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PCCB (I-no. 1ZV):		
N 91252201	Collared cheese head bolt, M14	4 ea.
⇒ Damage Code WLA5 066 000 2		

Scope 8: **Only relevant** for vehicles with the following **version/equipment**:

- Steel springs (1BH)
- ACC (8T3, 8T8, 3V1, 3V2)

Working time:	
Replacing rear axle differential	Labor time: 1086 TU
Includes:	
Raising and lowering the vehicle	
Removing and installing wheels on the rear axle	
Removing and installing rear cardan shaft	
Performing suspension alignment at front and rear and making adjustments	
Calibrating front camera	
Checking and adjusting steering-angle sensor for PSM	
Parts required:	
ODG500043HX	Rear axle differential 1 ea.
PAF107599	Cheese head bolt, M10 6 ea.
95534919121	Plate, M10 3 ea.
PAF91201301	Combination screw, M14 1 ea.

PAF91114701	Combination screw, M12	2 ea.
N 91228001	Hexagon-head bolt, M14	2 ea.
N 10629602	Hexagon-head bolt, M10	2 ea.
8E0407643A	Collared cheese head bolt, M16	2 ea.
95533212500	Circlip	2 ea.
N 10810701	Hexagon-head bolt, M8	2 ea.
N 91228901	Hexagon-head bolt, M10	2 ea.
N 10272302	Hexagon-head bolt, M10	2 ea.
958007096	Hexagon-head bolt, M12	2 ea.
N 10106403	Hexagon nut M14	2 ea.
N 91237101	Hexagon-head bolt, M14	2 ea.
PAF006496	Hexagon-head bolt, M14	4 ea.
N 10629602	Hex flange bolt, M10	2 ea.
N 10699401	Hexagon-head bolt, M10	2 ea.
N 10456004	Internal hexagon round countersunk screw, M6	4 ea.
Also for vehicles with 18-inch disc brakes (I-no. 1ZJ, 1ZB, 1ZH, 1ZS):		
WHT004571	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PSCB (I-no. 1ZI):		
N 91183701	Collared cheese head bolt, M14	4 ea.
or		
Also for vehicles with PCCB (I-no. 1ZV):		
N 91252201	Collared cheese head bolt, M14	4 ea.

⇒ Damage Code WLA5 066 000 2

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2020 Porsche Cars North America, Inc.