

**Complaint - Squealing Noises from the Front Axle Area When you Press the Brake:  
Replacing Brake Pads (63/20)**

Revision: This bulletin is replacing bulletin Group 4 63/20, dated May 14, 2020.

Model Year: **As of 2019 up to 2020**

Vehicle Type: **Macan (95B)**

Country/Market: **USA (C02)  
Canada (C36)**

Equipment: **Front gray cast-iron brake discs (I-no. 1LE)**

Subject: **Front brake pads**

Information: Squealing noises can be heard from the front axle area when you press the brake.

Remedial Action: Check the brakes for significant signs of wear and damage. If wear or damage can be ruled out as the cause, install ECE brake pads (I-no. 1LA).

**Required spare parts**

Spare Parts:	<b>Part No.</b>	<b>Designation</b>	<b>Qty.</b>
	9A769815100	⇒ Set of brake pads	1 ea.
	PAF911476	⇒ Hex flange bolt	4 ea.
	8R0615269A	⇒ Spring	2 ea.
	9A761514500	⇒ Retaining pin	4 ea.

**Preparatory work**

- Work Procedure: 1 Check front disc brake pads, see ⇒ *Workshop Manual '463602 Checking front disc brake pads'*.
- 2 Check front brake discs, see ⇒ *Workshop Manual '465002 Checking front brake discs (grey cast-iron)'*.

**Replace brake pads**

- Work Procedure: 1 Replace front disc brake pads, see ⇒ *Workshop Manual '463656 Replacing front disc brake pads (R4)'*.

**Information**

**Please pay careful attention when installing the pads. They are directional and need to be installed accordingly.**

- The use of ECE brake pads can result in more brake dust.
- New brake pads need a bedding-in time of approx. 200 km (125 miles). Only then, they do achieve their best friction coefficient and wear values.
- The pedal feel or braking effect can change slightly when using ECE brake pads.

**Invoicing**

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers specified below in the warranty claim:

APOS	Labor operation	I No.
46360201	Checking front disc brake pads	
46500201	Checking front brake discs	
46365600	Replacing front disc brake pads	

PQIS coding:

Location (FES5)	46360	Front disc brake pad
Damage type (SA4)	2019	Squealing

Parts Info:	Part No.	Designation	Qty.
	9A769815100	⇒ Set of brake pads	1 ea.
	PAF911476	⇒ Hex flange bolt	4 ea.
	8R0615269A	⇒ Spring	2 ea.
	9A761514500	⇒ Retaining pin	4 ea.

References: ⇒ *Workshop Manual '463602 Checking front disc brake pads'*  
 ⇒ *Workshop Manual '465002 Checking front brake discs (grey cast-iron)'*  
 ⇒ *Workshop Manual '463656 Replacing front disc brake pads (R4)'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2020 Porsche Cars North America, Inc.