

TITLE: Manual Service Disconnect Replacement**Type: Customer Satisfaction Campaign****Year: 2020****Applicability: MY20 Revero GT****System: Electric Drive****Market Region: All****Sequence: 01**

Purpose: There is a specification change in the Manual Service Disconnect (MSD). Replace the current installed unit in the vehicles listed on the following page.

Prior to pulling the MSD, Turn off and wait for vehicle enter sleep mode (make sure HV contactors are open).

Disconnect the 12-Volt, remove the fuse #21 (BECM fuse) then remove the MSD, found under the rear LH (driver) side seat cushion. Replace with the new MSD, part number C131118006302, reinsert fuse #21, and reconnect the 12-volt.

The new MSD has a 400A rating.

Clear all DTC's if any, and calibrate the windows.

Destroy the original MSD – with the MSD removed, drill a hole into the warning sticker.

Photograph, label with the last 8 of the VIN, then discard the old part.


Create a TSS case to record the completion of this campaign.

Attached a photo, to the TSS case, of the destroyed 550A MSD.

Additionally, MSD replacement is recommended after performing any High-Voltage (HV) system servicing.

MSD replacement after HV system repairs should be performed when all diagnosis and repair has been completed.

Use the MSD part number C131118006302 during the diagnosis phase of the HV system repair, if needed, and replace the original MSD with a new unit after having completed the repair process.

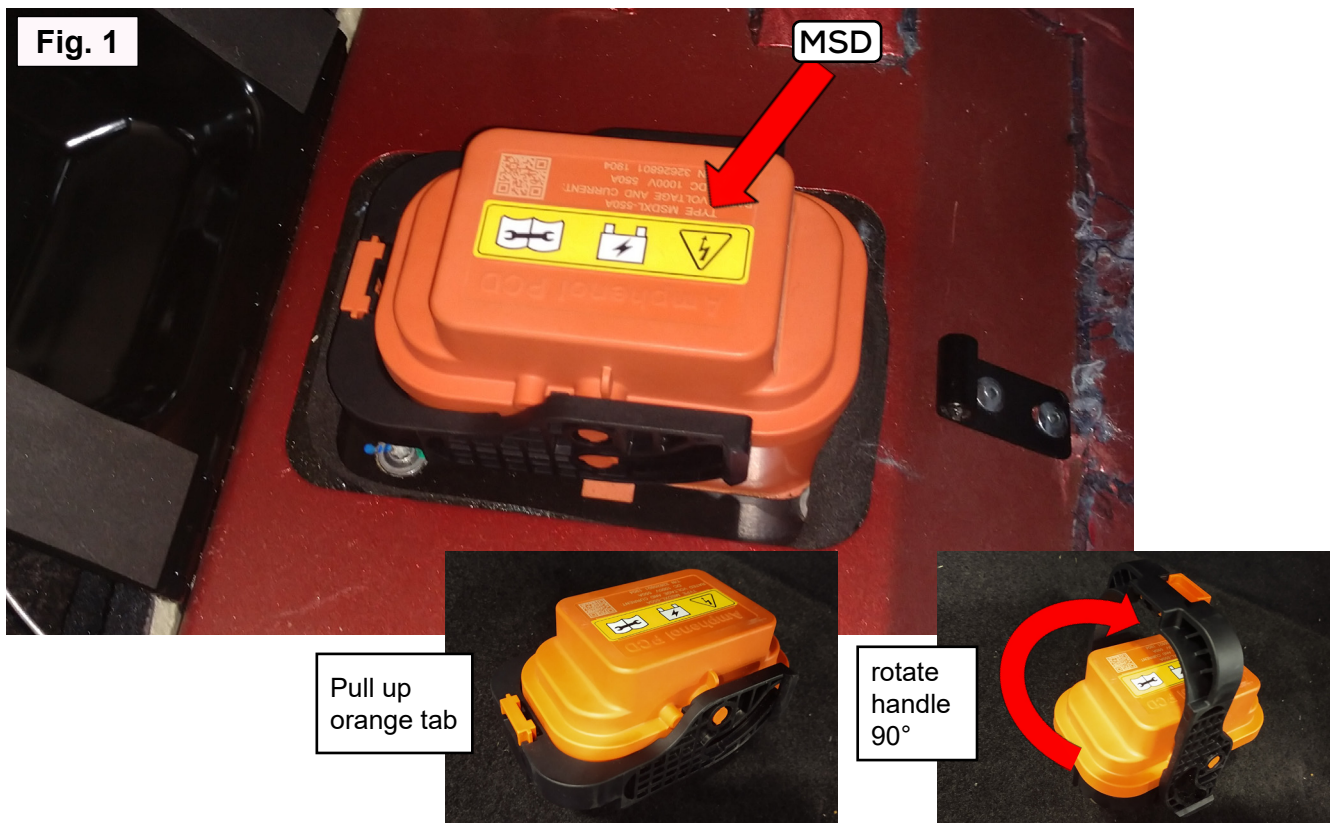

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.

50GK43SB4LA000002	50GK43SB7LA000057	50GK43SBXLA000103	50GK43SB4LA000162
50GK43SB3LA000010	50GK43SB9LA000058	50GK43SB1LA000104	50GK43SB8LA000164
50GK43SB6LA000017	50GK43SB0LA000059	50GK43SB3LA000105	50GK43SBXLA000165
50GK43SB8LA000021	50GK43SB7LA000060	50GK43SB5LA000106	50GK43SB7LA000169
50GK43SBXLA000022	50GK43SB9LA000061	50GK43SB7LA000107	
50GK43SB1LA000023	50GK43SB0LA000062	50GK43SB9LA000108	
50GK43SB3LA000024	50GK43SB2LA000063	50GK43SB0LA000109	
50GK43SB5LA000025	50GK43SB6LA000065	50GK43SB9LA000111	
50GK43SB7LA000026	50GK43SB8LA000066	50GK43SB2LA000113	
50GK43SB9LA000027	50GK43SBXLA000067	50GK43SB4LA000114	
50GK43SB0LA000028	50GK43SB1LA000068	50GK43SB6LA000115	
50GK43SB2LA000029	50GK43SB3LA000069	50GK43SBXLA000120	
50GK43SB9LA000030	50GK43SBXLA000070	50GK43SB1LA000121	
50GK43SB0LA000031	50GK43SB1LA000071	50GK43SB3LA000122	
50GK43SB2LA000032	50GK43SB3LA000072	50GK43SB7LA000124	
50GK43SB4LA000033	50GK43SB5LA000073	50GK43SB9LA000125	
50GK43SB6LA000034	50GK43SB7LA000074	50GK43SB0LA000126	
50GK43SB8LA000035	50GK43SB9LA000075	50GK43SB2LA000127	
50GK43SBXLA000036	50GK43SB0LA000076	50GK43SB4LA000128	
50GK43SB1LA000037	50GK43SB2LA000077	50GK43SB6LA000129	
50GK43SB3LA000038	50GK43SB4LA000078	50GK43SB2LA000130	
50GK43SB5LA000039	50GK43SB6LA000079	50GK43SB4LA000131	
50GK43SB1LA000040	50GK43SB2LA000080	50GK43SB6LA000132	
50GK43SB3LA000041	50GK43SBXLA000084	50GK43SB8LA000133	
50GK43SB5LA000042	50GK43SB1LA000085	50GK43SBXLA000134	
50GK43SB7LA000043	50GK43SB3LA000086	50GK43SB3LA000136	
50GK43SB9LA000044	50GK43SB5LA000087	50GK43SB5LA000137	
50GK43SB0LA000045	50GK43SB7LA000088	50GK43SB7LA000138	
50GK43SB2LA000046	50GK43SB9LA000089	50GK43SB9LA000139	
50GK43SB4LA000047	50GK43SB5LA000090	50GK43SB5LA000140	
50GK43SB6LA000048	50GK43SB7LA000091	50GK43SB9LA000142	
50GK43SB8LA000049	50GK43SB9LA000092	50GK43SB0LA000143	
50GK43SB4LA000050	50GK43SB0LA000093	50GK43SB2LA000144	
50GK43SB6LA000051	50GK43SB2LA000094	50GK43SB8LA000147	
50GK43SB8LA000052	50GK43SB8LA000097	50GK43SBXLA000148	
50GK43SBXLA000053	50GK43SB1LA000099	50GK43SB1LA000149	
50GK43SB1LA000054	50GK43SB4LA000100	50GK43SB3LA000153	
50GK43SB3LA000055	50GK43SB6LA000101	50GK43SB0LA000157	
50GK43SB5LA000056	50GK43SB8LA000102	50GK43SB2LA000161	

TITLE: Manual Service Disconnect Replacement**Type: Customer Satisfaction Campaign****Year: 2020****Applicability: MY20 Revero GT****System: Electric Drive****Market Region: All****Sequence: 01****PARTS REQUIRED:**

PART NUMBER	DESCRIPTION	QTY
C131118006302	Manual Service Disconnect - Fused Top K1 2.0	1

SHOP SUPPLIES:

DESCRIPTION
N/A

SPECIAL TOOLS and PARTS:

PART NUMBER	DESCRIPTION	QTY
N/A		

LABOR CODES:

CODE	DESCRIPTION	TIME	DEFECT CODE
16-20-02-10	New Spec MSD Replacement	0.7	16-20-10-17

SUBLET:

CODE	DESCRIPTION	AMOUNT
N/A		

CAUSAL PART:

PART NUMBER	DESCRIPTION
C131118006302	Manual Service Disconnect - Fused Top K1 2.0

WARRANTY DISPOSITION:

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.