

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 75133 - MIL on the Instrument Cluster with P0521-85 Stored in the PCM

Models : XE / X760
XF / X260

Engineer :McArthur Elyse

Date Last :09 NOV 2020 15:54:01

Updated :

Content :Issue: Customer may report a Check Engine Light with oil pressure DTC P0521-85 "High Engine Oil Pressure Sensor/ Switch 'A' Range/ Performance- Signal above allowable range"

Cause: Contamination of the oil pump control solenoid can cause sticking of the hydraulic control valve resulting in the above customer concern and DTC.

Action: Replace the oil pump if the engine serial number is prior to the following:

- X260- ESN 180305W0029204DTD
- X760- ESN 180305W0028204DTD

Version : 1