




Technical Service Bulletin

SUBJECT:			No: TSB-20-15-002
ABNORMAL NOISE FROM EXHAUST HANGER			DATE: November 2020
			MODEL: 2014-20 Mirage, Mirage G4,
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER

PURPOSE

A customer may complain of an abnormal noise coming from the exhaust area while driving. This may occur due to vibration between the exhaust hanger and body side bracket. As the vibration intensifies, the gap at the damper increases in size and the hanger hits the bracket creating an abnormal noise.

This TSB instructs dealers to replace the two identified hanger rubber parts with new parts.

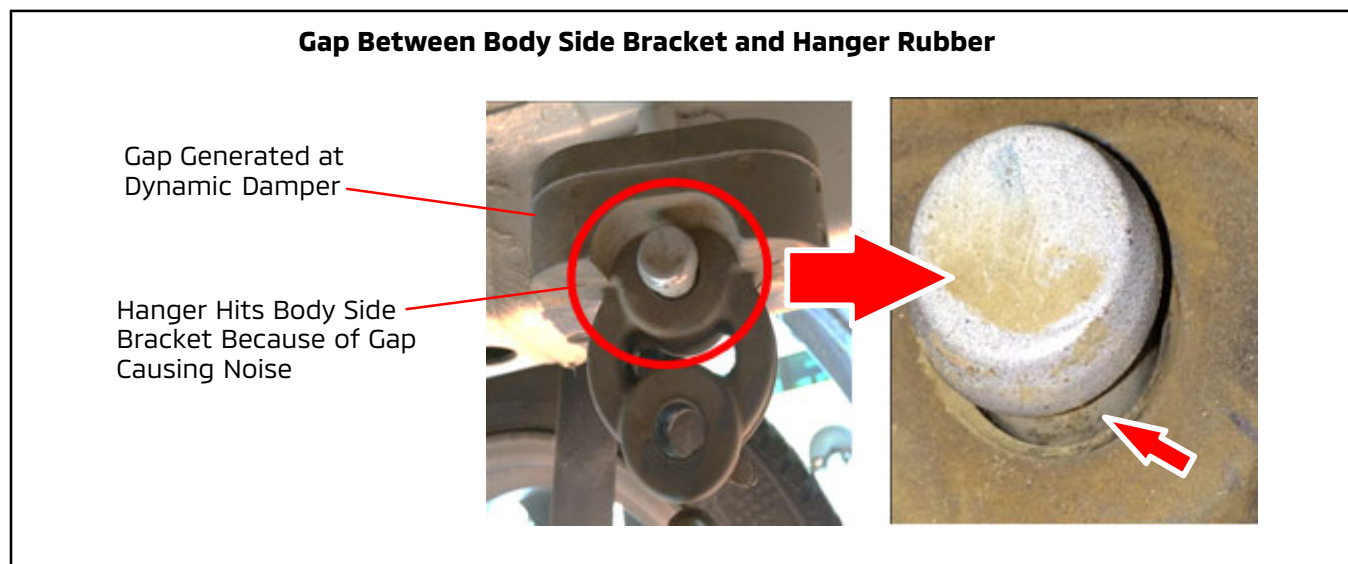


AFFECTED VEHICLES

- 2014 - 2020 Mirage vehicles built **before** March 5, 2020 (VIN: ML32A3HJ4LH008857)
- 2017 - 2020 Mirage G4 vehicles built **before** March 3, 2020 (VIN: ML32F3FJ2LHF11147)

REPAIR PROCEDURE


Replace the Exhaust Muffler Hanger with the new part number 1577A390 at position 2 and 3 as shown below.

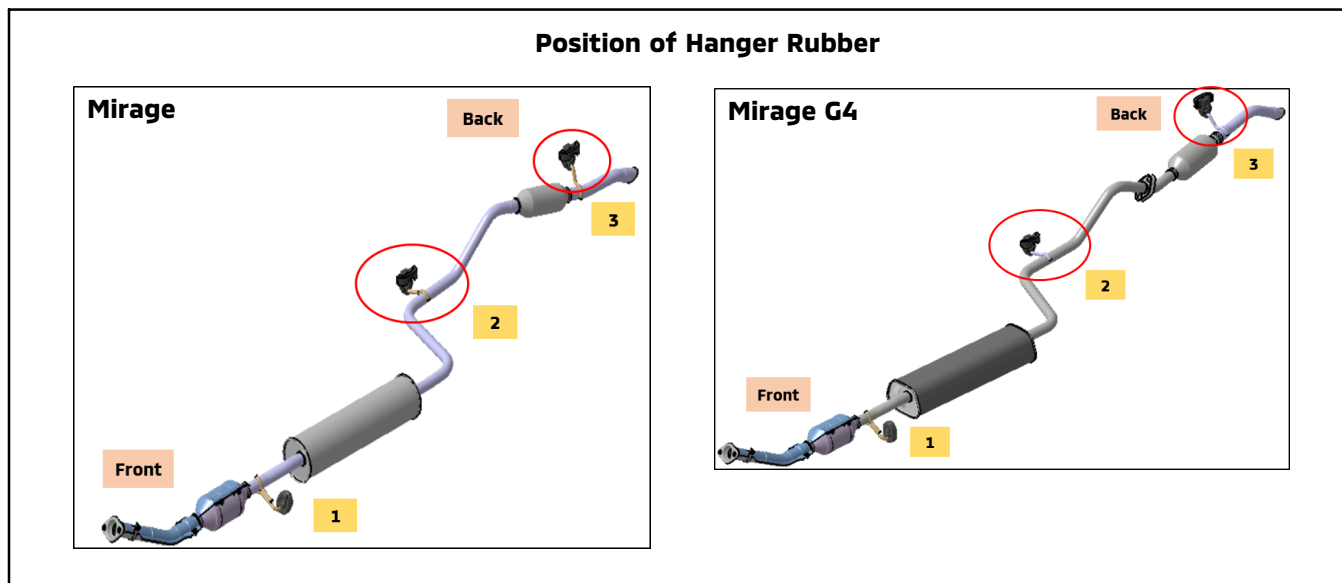

PARTS INFORMATION

Order only the Genuine Mitsubishi Parts listed below.

Model	Part Name	Part Number	Quantity
Mirage	Hanger, Exhaust Muffler	1577A390	2
Mirage G4			

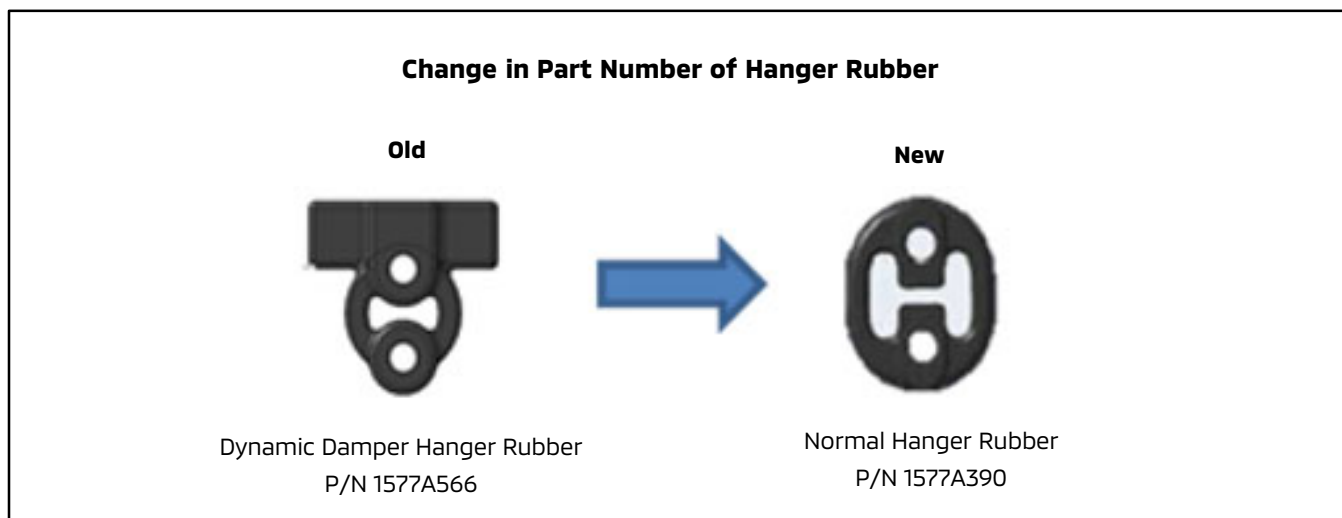



Old hanger (position 3)



New hanger (position 2)

WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the following information.

Labor Operation Code	Operation	Nature Code	Cause Code	Time Allowance
153512YS	Replace Exhaust Muffler Hanger - 2 pieces (position 2 and 3)	54Z	160	0.4 hrs

Warranty Coverage: 5/60 Basic Coverage (Canada: 5/100)