
 <b>HYUNDAI</b> <b>Technical Service Bulletin</b>	GROUP <b>Body</b>	NUMBER <b>20-BD-010H-2</b>
	DATE <b>November, 2020</b>	MODEL(S) <b>Accent (RB), Accent (HC) Elantra (MD/UD), Azera (HG), Sonata (LFa), Sonata Hybrid (LF HEV)</b>
<b>SUBJECT: TRUNK LATCH BASE REPLACEMENT</b>		

This TSB supersedes 20-BD-010H-1 to include the 2018MY Sonata (LFa) and Sonata Hybrid (LF HEV).

**Description:** The trunk latch base can be ordered separately from the trunk latch assembly. This bulletin describes the procedure to replace the trunk latch base.

**Applicable Vehicles:** Certain 2014 – 2017MY Accent (RB), 2018MY and newer Accent (HC), 2013 – 2016MY Elantra (MD/UD), 2015 – 2017MY Azera (HG), 2015 – 2018MY Sonata (LFa), and 2015 – 2018MY Sonata Hybrid (LF HEV) vehicles.

**Parts Information:**

Model	Part Number	Part Name
Accent (RB) Accent (HC)	81231-1R020FFF	 Trunk Lid Latch Base
Elantra (MD/UD) - Power	81231-3X010FFF	
Elantra (MD/UD) - Manual	81231-3X000FFF	
Azera (HG)	81231-C1000FFF	
Sonata (LFa), Sonata Hybrid (LF HEV)	81231-C1010FFF	

 
**Warranty Information:**

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSE CODE
Accent (RB) Accent (HC) Elantra (MD/UD) Sonata (LFa) Sonata Hybrid (LF HEV)	81231F01	Trunk Latch Partial Repair	0.3 M/H	Refer to the table above for the applicable P/N	I11	ZZ3
Azera (HG)	81231F02	Trunk Latch Partial Repair	0.4 M/H			

**NOTE:** Normal warranty applies.

**Service Procedure:**

1. Remove the trunk latch assembly according to the applicable vehicle shop manual.



2. Remove the four trunk latch assembly screws.



3. Replace the trunk lid latch base and reuse the actuator.



When reusing the actuator, do not contaminate the motor area.



Latch Base



Actuator

4. Reinstall the removed parts in reverse order of removal.
5. After reassembly, verify that the trunk operates normally.
6. The service procedure is now complete.