

## General Information

Some Walk-In Vans manufactured from January 1, 2020 through October 7, 2020 and equipped with an Interlube Chassis Lubrication System may experience leaks at the lubrication injectors. The injectors may not have been tightened properly.

At the next regularly scheduled maintenance interval, inspect the bottom of the Interlube pump for leaks. If there are any signs of lubricant on the pump, use a 12 mm wrench and turn all of the injectors and blanking plugs 1/8 to 1/4 inch clockwise. Do not overtighten the blanking plugs. See [Fig. 1](#).



**Fig. 1, Tightening the Injectors and Blanking Plugs**

## Warranty

This is an informational bulletin only. Warranty does not apply.