



Technical Service Bulletin

SECTION 1 – INITIATION OF REQUEST

DATE:	12/01/2020	BULLETIN #	RE-12.09.2020	REVISION:	Rev 1
KIT #:	RE1689	PART #:	RM14059	QUANTITY:	3415
BRAND:	Rubicon Express	DESCRIPTION:	FRT FORGED HD ADJ TRK BAR JK / JL / 2020 JT RUBICON		
DESCRIPTION OF PROBLEM:		The kit RE1689 was designed to be compatible with the following vehicle platforms: JK & JL & JT. One of the stores found during the kit installation of the RE1689 the component RM14059 doesn't have enough clearance to assemble with the OEM suspension, this was found only for the Jeeps JT 2018 – current.			

SECTION 2 – RECEIPT

☐ MANUFACTURING	☒ ENGINEERING	☒ QUALITY	☐ CSR
--	---	---	------------------------------

SECTION 3 – REASON & DISPOSITION OF PARTS

SUGGESTED SOLUTION:	<p>During installation: May need to sand down as much as 0.125" the trackbar bracket axle if they pose a problem when installing. Update instructions with necessary tools and actions for installer and customers to take.</p> <p>See Page 2 for photos once fix.</p> <p>Part: New ECR to add a .1 x 45 deg chamfer to RM14059 in process as well</p>
PARTS:	RM14059
TEST:	Visually inspect the assembly to have clearance.

Please contact our Customer Service Tech Department at (800)-776-0767. They will be able to assist you with any questions you may have regarding this issue.

TRANSAMERICAN AUTOPARTS
400 W. Artesia Blvd.
Compton CA 90220
TOLL FREE: (800)-776-0767 Fax: 310-747-3912



Technical Service Bulletin



Before TSB



After TSB

SECTION 4 – VISUAL REPRESENTATION OF THE FIX

Please contact our Customer Service Tech Department at (800)-776-0767. They will be able to assist you with any questions you may have regarding this issue.

TRANSAMERICAN AUTOPARTS
400 W. Artesia Blvd.
Compton CA 90220 TOLL FREE: (800)-776-0767 Fax: 310-747-3912