

68 Glove box door is binding when opened or closed

68 20 26 2060899/2 December 2, 2020. Supersedes Technical Service Bulletin Group 68 number 20-25 dated October 7, 2020 for reasons listed below.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|-------------|-----------|----------------------------|
| Q5, SQ5 | 2019 - 2020 | All | Not Applicable |

Condition

| REVISION HISTORY | | | | | |
|------------------|------------|--|--|--|--|
| Revision | Date | Purpose | | | |
| 2 | - | Revised title Revised Service (Updated tightening procedure) | | | |
| 1 | 10/07/2020 | Initial publication | | | |

Customer states:

• The glove box door is binding on open and/or close.

Workshop findings:

• The gap between the center console and the glove box door is insufficient.

Technical Background

Tolerances during assembly.

Production Solution

Improved assembly process starting CW37/20.



Service

 Loosen all 7 glove box bolts (Figure 1).



Figure 1. Glove box bolt tightening sequence

 While pulling the glove box door outward in direction of the A-Pillar, tighten the glove box bolts according to the sequence outlined in this TSB (Figure 1, Figure 2).



Figure 2. Adjusting the glove box to increase clearances.



Check the gap between the center console and the glove box door to ensure adequate clearance (Figure 3).



Figure 3. Checking the gap between the glove box door and the center console.

4. Check the operation of the glove box door.

Warranty

| Claim Type: | • 110 up to 48 Months/50,000 Miles. | | | | | | |
|-------------------|--|--------------|-------|--|--|--|--|
| | G10 for CPO Covered Vehicles – Verify Owner. | | | | | | |
| | If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | | | | | |
| Service Number: | 6812 | | | | | | |
| Damage Code: | 0010 | | | | | | |
| Labor Operations: | Adjust the Glove Box | 6815 1599 | 20 TU | | | | |
| Diagnostic Time: | GFF | No allowance | 0 TU | | | | |
| | Road test prior to the service procedure | No allowance | 0 TU | | | | |
| | Road test after the service procedure | No allowance | 0 TU | | | | |
| Claim Comment: | As per TSB #2060899/2 | | | | | | |



All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (2060899) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.