

# **Technical Service Bulletin**

#### 91 MIB2+ Standard: the MMI screen is fuzzy, blurry or flickering

91 20 46 2061031/2 December 16, 2020. Supersedes Technical Service Bulletin Group 91 number 20-19 dated October 15, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2019 - 2020	All	MIB2+

### Condition

REVISION HISTORY				
Revision	Date	Purpose		
2	-	Revised title (Added conditions) Revised <i>Condition</i> (Added symptom) Revised <i>Service</i> (Added step)		
1	10/15/2020	Initial publication		

#### **Customer states:**

• The MMI screen picture appears fuzzy or blurry (Figure 1).

Or

• The MMI screen is flickering.



Figure 1. The MMI screen is fuzzy.

© 2020 Audi of America, Inc.

Page 1 of 3

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



## Technical Service Bulletin

#### Workshop findings:

• No relevant DTC is entered in the vehicle.

### **Technical Background**

A software bug in the display driver can cause the screen to become permanently fuzzy.

### **Production Solution**

New display software introduced in MY2021.

#### Service

- 1. Please take photos of the customer concern and upload them into DOC-IT with the repair order. Photos should:
  - Have a date stamp and VIN reference.
  - Be taken in focus and with sufficient light.
- 2. Replace the information electronics control module, J794 (address word 005F).

#### Warranty

Claim Type:	<ul> <li>110 up to 48 Months/50,000 Miles.</li> <li>G10 for CPO Covered Vehicles – Verify Owner.</li> <li>If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
Service Number:	9196		
Damage Code:	0039		
Labor Operations:	ECM information display control head remove + reinstall	9196 1900	See SRT with associated operations
Diagnostic Time:	GFF – Checking and clearing fault codes included in existing labor operations	No allowance	0 TU

© 2020 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



## Technical Service Bulletin

	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2061031/2		

All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.

### **Required Parts and Tools**

Always check with yo	Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.			
Part Number	Part Description	Quantity		
See ETKA	Information Electronics Control Module (J794)	01		

## **Additional Information**

All parts and service references provided in this TSB (2061031) are subject to change and/or removal.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.

© 2020 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.