



# Preliminary Information

## PIT5626C Intermittent Communications Concerns - Possible Multiple MILs on U0073 or Multiple U-Codes Stored

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2016 - 2021	All	All	LCV	All
GMC	Canyon	2016 - 2021	All	All	LCV	All

<b>Involved Region or Country:</b>	<b>North America</b>
<b>Condition:</b>	<b>Intermittent multiple MIL's or messages, loss of communication, potential U-codes.</b>
<b>Cause:</b>	<b>Main harness chaffed under hood.</b>

### Correction:

Check for harness chaffing on the low side A/C pipe, left side below the exhaust manifold. This is best observed through the left wheel well opening.



### Service Procedure:

Repair per instructions in SI and secure harness away from the pipe.

The plant is investigating the root cause and will put in corrective action.

### Version History

Version	4
<b>Created</b>	07/31/2018 - Created on 07/09/2019 - Updated to include 2019 Model Year. 10/16/2019- Updated to add 2020 Model Year. 12/09/2021- Updated to add the 2021 Model Year.



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.