

Service

Category Audio/Visual/Telematics

Section Cellular Communication Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2021	Avalon, Avalon HV, Corolla, Corolla HV, Sienna HV, Venza HV		
2020 - 2021	Camry, Camry HV, Corolla Hatchback, RAV4, RAV4 HV		

REVISION NOTICE

December 14, 2020 Rev1:

- Applicability has been updated to include 2021 model year Venza Hybrid, Avalon, Avalon Hybrid, and Sienna Hybrid vehicles.
- Applicability has been updated to exclude 2021 model year RAV4 Prime vehicles.
- The Introduction section has been updated.

Any previous printed versions of this bulletin should be discarded.

SUPERSESSION NOTICE

The information contained in this bulletin supersedes Service Bulletin No. T-SB-0021-20.

- Applicability has been updated to include 2021 model year Camry, Camry Hybrid, Corolla, Corolla Hatchback, Corolla Hybrid, RAV4, RAV4 Hybrid, and RAV4 Prime vehicles.
- The Introduction and Firmware Update Procedure sections have been modified.

Service Bulletin No. T-SB-0021-20 is obsolete and any printed versions should be discarded.

September 30, 2020

DCM Reset and Firmware Update (LG)

Introduction

Some 2020 model year Camry, Camry Hybrid, Corolla Hatchback, RAV4, and RAV4 Hybrid vehicles may exhibit one or more of the following conditions:

- Diagnostic Trouble Code (DTC) B15A804 is present in current or history.
- Red SOS LED stays on after bulb check.
- Toyota App does not accept the activation code.
- Toyota App is inoperative.
- SOS call center does not receive the vehicle's location in a timely manner.
- Toyota App shows an error 42 when trying to execute a command.
- Unable to remote start the vehicle with the key fob (if equipped).
- Unable to subscribe to remote services.
- Unable to activate Wi-Fi.
- Destination Assist is inoperative.

Some 2020 – 2021 model year Camry, Camry Hybrid, Corolla Hatchback, RAV4, and RAV4 Hybrid vehicles and some 2021 model year Avalon, Avalon Hybrid, Corolla, Corolla Hybrid, Sienna Hybrid, and Venza Hybrid vehicles may exhibit one or more of the following conditions:

- DTC B15A804 is present in current or history.
- Red SOS LED stays on after bulb check.
- Toyota App is inoperative.
- Unable to subscribe to remote services.
- Unable to activate Wi-Fi.
- Depleted 12V vehicle battery when in IG-OFF.

A DCM reset and firmware update is now available to address these conditions. Follow the DCM Reset and Firmware Update Procedure in this bulletin to update the firmware.

Warranty Information

0	P CODE	DESCRIPTION	TIME	OFP	T1	T2
Е	EL1934	DCM Reset and Firmware Update	0.8	86741-####	87	74

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Page 3 of 9

DCM Reset and Firmware Update (LG)

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream ADVI*	ADE	TSADVUNIT	
Techstream 2.0		TS2UNIT	
Techstream Lite		TSLITEPDLR01	1
Techstream Lite (Green Cable)		TSLP2DLR01	

^{*}Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 15.30.027 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.
- Use Techstream or an approved J2534 interface to perform flash reprogramming updates. Visit <u>techinfo.toyota.com</u> for more information regarding J2534 reprogramming.

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Battery Diagnostic Tool*	DCA-8000P_T	1

^{*}Essential SST.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.




DCM Reset and Firmware Update Procedure

- Move the vehicle to an area with good DCM (Data Communication Module) signal reception.
- 2. Using Techstream, perform a Health Check and clear ALL DTCs.
 - A. Check the "Perform Health Check on all ECUs" box.
 - B. Check the "Store only DTC and FFD" box.
 - C. Click on Next.

Figure 1.

September 30, 2020

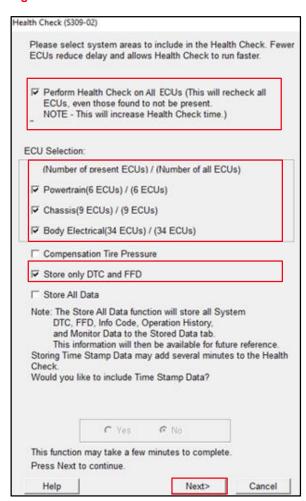

T-SB-0095-20

DCM Reset and Firmware Update Procedure (continued)

Verify the current firmware version.
 Refer to TIS – Body Electrical – Telematics – Data List:

Rev1

Table 1: Current Firmware Version.

	PREVIOUS	CURRENT
SOFTWARE VERSION HIGH	LG-N010dd7 LG-N010ee9 LG-N010ffB	LG-N010gg7
SOFTWARE VERSION LOW	575-57 575-55 191-13 191-b9 191-24 CBC-34 CBC-98	G7G-05 G7G-c7

Is the firmware version up to date?

- YES This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- NO Continue to step 4.
- 4. Disconnect the battery to reset the DCM.
- 5. Reconnect the battery AFTER it has been disconnected for AT LEAST 30 minutes.
- 6. Cycle the ignition to the IG-ON position IMMEDIATELY.
- 7. Verify the SOS LED indicator status.

Has the SOS LED indicator been on solid green for more than five seconds?

- YES Continue to step 8.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 8. Perform the DCM firmware update utility. Refer to TIS – Body Electrical – Telematics – Utility.

Figure 2.


All Readiness	DCM Operation History	^
Vehicle Control History (RoB)	Cancel Communication Function Pausing	
Remote Door Lock Setting	Backup Battery Replacement Reset	
DCM Firmware Update	Emergency Call Cancellation	
Customize	VIN Synchronization	

T-SB-0095-20

DCM Reset and Firmware Update Procedure (continued)


9. Click on Next when the DCM firmware update screen appears.

Figure 3.

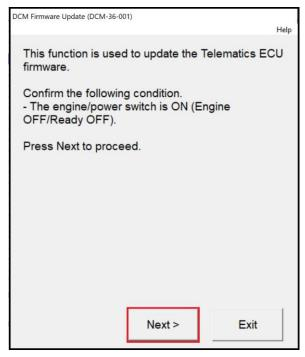

10. Select "Start the firmware update" and click on Next when the item selection screen appears.

Figure 4.

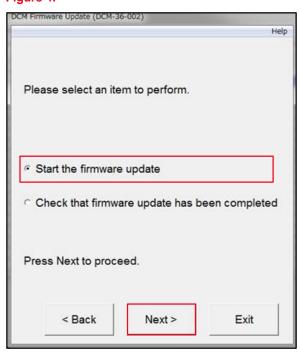

DCM Reset and Firmware Update (LG)

T-SB-0095-20

DCM Reset and Firmware Update Procedure (continued)

 Click on Next when the current software part number screen appears.

NOTE

If the screen in Figure 5 does NOT appear and an error message displays, begin the Firmware Update Procedure again from step 4. The battery reset MUST be performed again.

Use the battery diagnostic tool to maintain battery voltage.

NOTE

- The battery diagnostic tool MUST be used in Power Supply Mode to maintain battery voltage at 13.5V while flash reprogramming the vehicle.
- For details on how to use the battery diagnostic station, refer to the <u>DCA-8000 Instruction Manual</u> located at TIS – Diagnostics – Tools & Equipment – Battery Diagnostics.
- The firmware update will begin. Do NOT turn the vehicle OFF during this time.


NOTE

- Do NOT press Exit until the update process has completed.
- During the update process, the green and red LEDs will both be ON and will reset several times resulting in the LEDs being temporarily OFF during the process. The download process will take about 5 – 10 minutes.

Figure 5.



Figure 6.

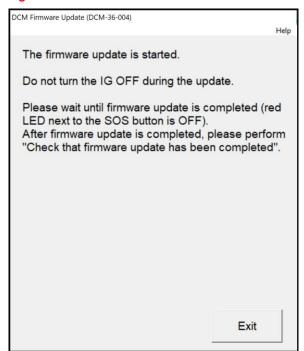


DCM Reset and Firmware Update (LG)

CONTACT

DCM Reset and Firmware Update Procedure (continued)

13. The green LED will be ON when the update process has completed. AFTER the process has completed, wait for the radio screen to display the service mode screen BEFORE you click OK to exit.

Figure 7.

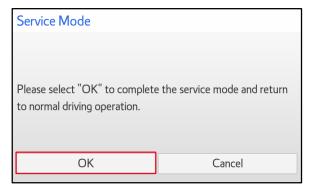

14. Verify the current firmware version.

Refer to TIS – Body Electrical – Telematics – Data List:

Table 2: Current Firmware Version

	CURRENT FIRMWARE VERSION
SOFTWARE VERSION HIGH	LG-N010gg7
SOFTWARE VERSION LOW	G7G-05 G7G-c7
	373-67

- 15. Using Techstream, perform a Health Check and clear ALL DTCs that may have occurred during the update process.
- In the customer's Toyota app, perform steps 17 – 19 for customers with the "Unable to Activate Remote" message.

Figure 8.



DCM Reset and Firmware Update Procedure (continued)

17. Click on the arrow by the vehicle name/nickname.

18. Click on REMOVE.

19. Click on Add Vehicle to perform the enrollment again.

Figure 9.

September 30, 2020

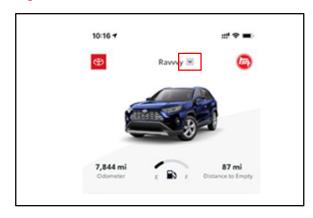


Figure 10.



Figure 11.

