



Volvo Chassis - Air Leak At Wet Tank - Model VNL



Internal Content

DEALER ID: A082736

CREATED BY: A082736

CREATED: Feb 13, 2020, 09:02PM

LAST CHANGED BY: A241298

LAST CHANGED: Mar 03, 2020, 03:33PM

QJ 1-12337163670

QJ Solution: Proposed solution is to S-Note the old metric fitting onto about 95 trucks. Plan is to use the S-Notes until the end of spec week 20W16 (no longer needed starting 20W17).

Volvo VN models have been reported having the wet tank, located on the front (outside) side of the wet tank, air line rub the chassis fairing. If the truck was built starting March 11, 2019 with air tank 22945941 and air fittings 991083 or 991965, in the front port of the air tank, this issue is possible. To correct this issue, replace fittings 991083 or 991965 with fitting 20999390.

Refer to the pictures below.

Fitting - 20999390	Global Fitting - 991083 / 991965
--------------------	----------------------------------





 Live UI





Tags

k52236323

vnl

volvo

Live UI

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article