

WLF6 Workshop Campaign - Replacing Turbocharger

Version 1

Overview

Some turbochargers were installed on the affected vehicles in which the lever for the wastegate valve was not manufactured in accordance with specifications.

As a result, the lever can break over the service life of the vehicle and the wastegate valve can then no longer be actuated to control the boost pressure.

To prevent consequential damage to the engine or turbochargers, limp-home mode is activated in this case and a corresponding warning message is displayed in the instrument cluster.

Depending on the assigned scope, one or both turbochargers must be replaced on the affected vehicles.

Please arrange for this measure to be carried out on the affected vehicles immediately.

Model type	911 Carrera S (992) 911 Carrera 4S (992)
Model year	2020
Number	35

Parts required

Scope 1:

Part No.	Designation	Quantity/vehicle	Parts return*
OPB145701K	Turbocharger	1 ea.	Yes

Scope 2:

Part No.	Designation	Quantity/vehicle	Parts return*
OPB145702K	Turbocharger	1 ea.	Yes

Scope 3:

Part No.	Designation	Quantity/vehicle	Parts return*
OPB145701K	Turbocharger	1 ea.	Yes
OPB145702K	Turbocharger	1 ea.	Yes

Other parts required:

The other parts required to carry out the campaign can be found in the respective Technical Information (TI).

*** All replaced turbochargers must be preserved at dealers until requested back as returns or requested to be scrapped. Please do not automatically scrap these parts, as the supplier may request them back.**

Parts Ordering

Please order parts as needed, with no requirement for PRMS ticket to order.

Warranty processing

Scope 1 - Replacing turbocharger for cylinders 1-3:

Damage Code	WLF6 66 000
-------------	-------------

Repair Code	2
-------------	---

Working time	420 TU
--------------	--------

Scope 2 - Replacing turbocharger for cylinders 4-6:

Damage Code	WLF6 66 000
-------------	-------------

Repair Code	2
-------------	---

Working time	414 TU
--------------	--------

Scope 3 - Replacing both turbochargers:

Damage Code	WLF6 66 000
-------------	-------------

Repair Code	2
-------------	---

Working time	611 TU
--------------	--------

Porsche Mobility

If requested, the mobility of the affected customer can be assured by offering a suitable replacement vehicle.

Please invoice this additional service with the campaign scope via WWS.

Further information

Exported/imported vehicles	Carry out the campaign
----------------------------	------------------------

Work instruction	TI No. 97/20, Group 2, Service, WLF6
------------------	--------------------------------------

Vehicle list and allocation	See PCSS or attached list for reference
-----------------------------	---

Technical Information*	See PCSS or Aftersales Document Database for reference
------------------------	--

[WLF6 VIN List.xlsx](#)

9.1 KB

(175 views)

Created by [Ryan Cooney](#) on Jan 8, 2021 4:20 PM. Last modified by [Ryan Cooney](#) on Jan 8, 2021 5:08 PM.

Categories: Workshop Campaigns, 911 Carrera

Tags : [911](#), [turbo](#), [992](#), [wlf6](#), [wastegate](#)

936 Views

[Report Abuse](#)

Content and Topics

Your Groups >

Your Content >

Your Places >

Personal

Edit Profile >

Change Password >

Manage

Admin Console >

PPN Administration >

Create

Discussion >

Files >

Document >

Collaboration >

Document

Blog Post >

Poll >

Event >

Photo Album >

Idea >

Space >

Group >

© 2021 Dr. Ing. h.c. F. Porsche AG. Legal notice. Copyright. Terms of use. [Privacy Policy](#). [Cookie Policy](#). [009](#)