

TECHNICAL TOPICS

ELECTRICAL



OS 2.0.7 MULTI-ECU SOTA UPDATE SUSPENDED

20MY L663 Defender

Customer Voice:

- OS 2.0.7 SOTA Update has been suspended

Technical Description:

- OS 2.0.7 Suspended due to a potential no start condition after the GWM is updated.
- Vehicles will continue to receive the OS 2.0.6 update until OS 2.0.7 is relaunched.

Status:

- OS 2.0.7 was suspended after 7 reports of no-start conditions after the customer initiated a software update.
- This failure will result in an RSA event as the GWM will prevent the vehicle to start.
- The Gateway Module (GWM can be updated via Pathfinder to repair any affected vehicle if Pathfinder has been updated to v313 which has been released today, 14-Jan-21.

