

TECHNICAL TOPICS

POWERTRAIN



Restricted Performance Message	17MY – Onward Range Rover, RR Sport, Discovery, RR Velar equipped with AJ126
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">– There is a restricted performance message in the instrument pack and a Check Engine MIL. <p><u>Technical Description:</u></p> <ul style="list-style-type: none">– DTC (s) are stored for the throttle.– The metal support ring from the intake tube has become loose and restricted movement of the throttle plate. <p><u>Status:</u></p> <ul style="list-style-type: none">– Should this condition be encountered, please replace the intake tube and retain both the tube and the ring for return.– Raise an EPQR including contact information (name, email address, and phone number) for someone who can serve as the point of contact for the shipping company to collect the original parts.	

