



Technical Service Bulletin

SUBJECT:		No: TSB-21-51-001	
GAP BETWEEN FRONT WHEEL ARCH MOLDING AND FENDER		DATE: January 2021	
		MODEL: 2011-20 Outlander Sport	
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER

PURPOSE

A customer may report a condition in vehicles equipped with a front wheel arch molding, where there is a gap between the front wheel arch molding and the fender. The front wheel arch molding is installed on the fender. When the position of the front wheel arch molding mounting hole is shifted, a gap may form over time.

This TSB instructs dealers to replace both sides of the wheel arch molding.




AFFECTED VEHICLES

2011 - 2020 Outlander Sport vehicles equipped with front wheel arch molding.

REPAIR PROCEDURE

Replace the front wheel arch molding with the countermeasure part on vehicles exhibiting this condition.

- Replace both sides at the same time. The countermeasure parts have a different front overfender pad shape than the existing parts.
- Refer to the applicable Service Manual, Group 51 Exterior, Overfender, Removal and Installation.

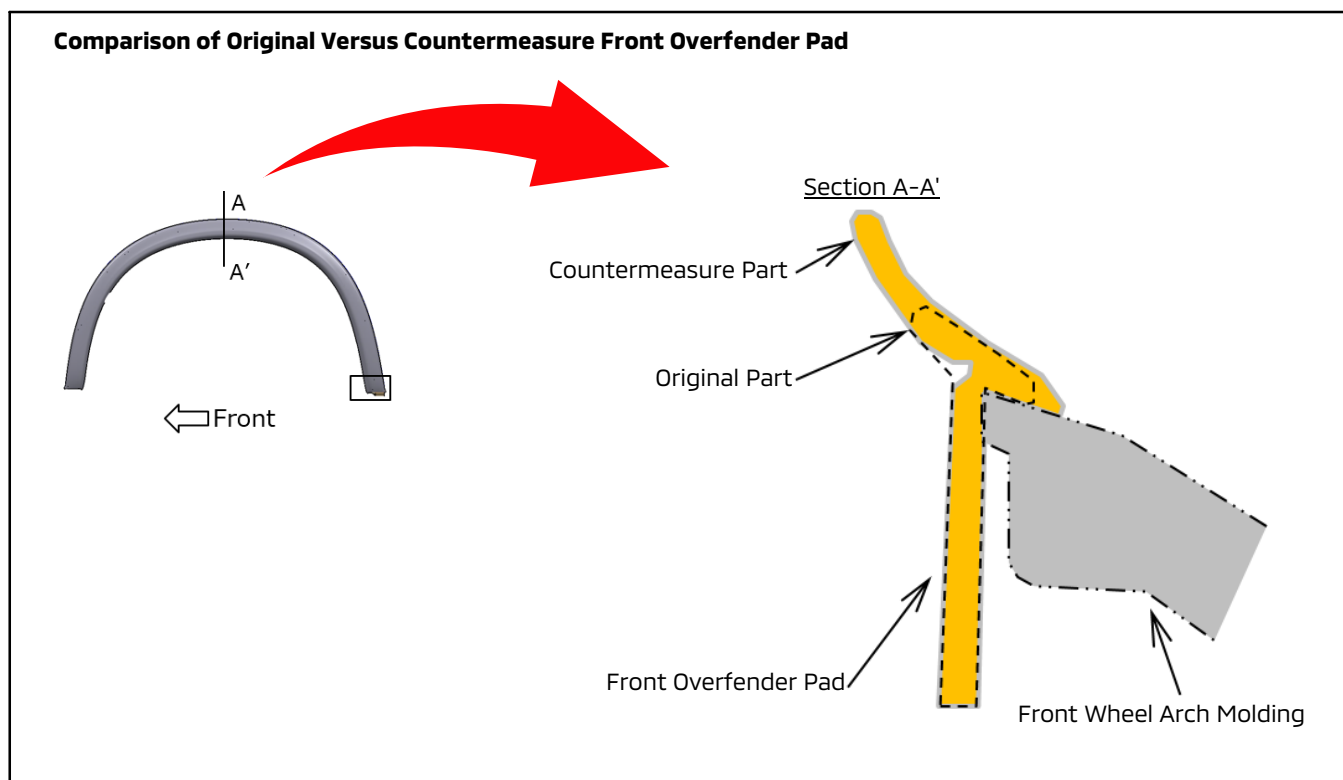

PARTS INFORMATION

Order only the Genuine Mitsubishi Parts listed below.

Production Period	Part Name		Part Number		Qty
			New	Old	
Beginning at Start of Production to 11/22/17	Molding, FR Wheel Arch	LH	5220AZ79	5220K207	1
		RH	5220AZ80	5220K208	1
		LH	5220AZ79	5220AA83	1
		RH	5220AZ80	5220AA84	1
From 11/22/17 to 5/21/19		LH	5220BA31	5220AD63	1
		RH	5220BA32	5220AD64	1
From 5/21/19 to Present		LH	5220BA33	5220AU13	1
		RH	5220BA34	5220AU14	1

WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the following information.

Labor Operation Code	Operation	Nature Code	Cause Code	Time Allowance
515110XV	Replace Front Overfender (Both Sides)	56D	450	0.5 hrs

Warranty Coverage: 5/60 Basic Coverage (Canada: 5/100)