

GROUP	NUMBER
STEERING	21-ST-001H
DATE	MODEL(S)
January 2021	Sonata (DN8) 2.5T Sonata (LFa) 2.0T Veloster N (JSN)

**Description:** The rack-mounted dual pinion Motor Driven Power Steering (MDPS) system components can be replaced separately from the complete assembly. This bulletin provides information on the separate components and the replacement procedure of these components.



Applicable Vehicles: All Sonata 2.0T (LFa), Sonata 2.5T (DN8a), Veloster N 2.0T (JSN)

# NOTICE

Refer to the applicable service manual for detailed information on service procedures and Diagnostic Trouble Code(s) (DTC).

**Parts Information: Dual-Pinion MDPS Components** 

Part Name	Image
MDPS Gear & Linkage Assembly	
Short Gear (MDPS Gear & Linkage Assembly without Power Pack and Lead Wire)	
Power Pack	
Lead Wire	
Power Pack Mounting Bolt – Mobis Spec (LFa, DN8a)	
Replace with a new bolt when replacing Power Pack.	
Power Pack Mounting Bolt – Mando Spec (JSN)	
Replace if the bolt thread is damaged or worn.	
Grease for Mando Systems	
The proper amount of grease is equivalent to a 50mm bead.	50mm
*Each tube of grease can be used on approximately 15 vehicles.	Part Number: YSBB0-91105-FFF

TSB #: 21-ST-001H Page 2 of 9

**Parts Information: Parts Table** 

Model	Full Assy	Short Gear	Power Pack	Power Pack Bolt	Rubber Coupling	Lead Wire	Note	
	57700-C2000	57770-C2000	56320- C2000	57138- 56380- L1000 C1500		56396- C2100	Mobis	
Sonata (LFa) 2.0T	57700-C2050	57770-C2050	56320- C2050			56396- C2100		
Sonata (DN8a) 2.5T	57700-C1700	57770-C1700	56320- C1170			56396- D4110		
	57700-L0000	57770-L1000	56370- L0100		56396- L1000			
	57700-K9000	57770-K9500	56320- K9000 56320- K9500	56320-				
Voloator N. (ICN)	57700-K9010	57770-S0210		5/138- D7090	-	56396- K9000	Mando	
Veloster N (JSN)	57700-K9500	57770-K9500						

## **Warranty Information:**

Model	Op Code	Operation	Op Time	Causal Part	Nature Code	Cause Code
	56500R00	Steering Gear Box Assembly Replacement	Refer to LTS for current LTS time	57700- C2000 57700- L0000	- D66	ZZ3
Sonata (LFa)	56555R00	Steering Short Gear Assembly Replacement				
2.0T	56505R00	Steering Power Pack Replacement				
	56396R00	Lead Wiring Assembly Replacement				
	56500R00	Steering Gear Box Assembly Replacement				
Sonata	56555R00	Steering Short Gear Assembly Replacement				
(DN8a) 2.5T	56505R00	Steering Power Pack Replacement				
	56396R00	Lead Wiring Assembly Replacement				

TSB #: 21-ST-001H Page 3 of 9

	56500R00	Steering Gear Box Assembly Replacement			
Veloster N	56555R00	Steering Short Gear Assembly Replacement		57700-	
(JSN)	56505R00	Steering Power Pack Replacement	K9000		
	56396R00	Lead Wiring Assembly Replacement			

NOTE: Dealers may claim \$0.10 on sublet for reimbursement of grease.

Mobis System Dual Pinion MDPS: Sonata (DN8a 2.5T, LFa 2.0T) Service Procedures:

#### **Power Pack & Short Gear Replacement**

 
1. Remove the steering gear box assembly from the vehicle. Refer to the applicable service manual procedures:

Steering system  $\to$  Motor driven power steering  $\to$  Steering gear box  $\to$  Repair procedures.



To prevent potential damage to the clock spring, lock the steering wheel in place before removing the steering gear box assembly.

Disconnect the power pack connectors (A).





### **Torque Specifications (Mobis):**

lb-ft	•14.5 - 17.4
kgf.m	•2.0 - 2.4
N.m	•19.6 - 23.5

## **NOTICE**

Replace the power pack mounting bolt with a new one.

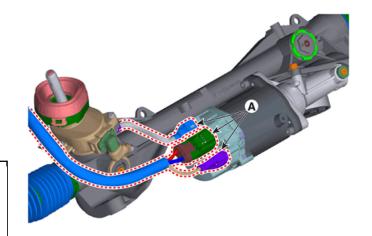

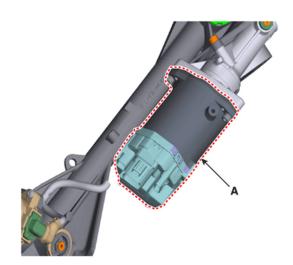

TSB #: 21-ST-001H Page 4 of 9

- If replacing the short gear assembly, transfer the removed power pack onto the new short gear assembly.
  - If replacing the power pack, install the new power pack onto the short gear assembly.

## **NOTICE**

When installing the power pack onto the short gear assembly, carefully align the coupler properly before tightening the mounting bolts.

If the coupling is damaged or deformed, replace the coupling.





- 4. Install the steering gear box assembly onto the vehicle. Install all parts in reverse order of removal.
- Using the GDS, perform the following functions in the Motor Driven Power Steering system:
  - Steering Angle Sensor (SAS) calibration
  - EPS Type Recognition




6. The service procedure is now complete.

TSB #: 21-ST-001H Page 5 of 9

#### **Lead Wire Replacement**

1. Disconnect the power pack connectors (A), then replace the lead wire (B).

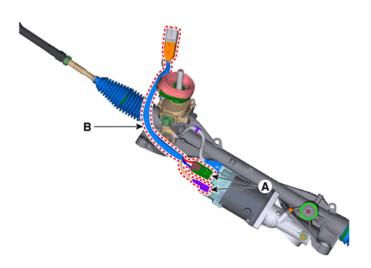

### Mando System Dual Pinion MDPS: Veloster N (JSN 2.0T) Service Procedures:


1. Remove the steering gear box assembly from the vehicle. Refer to the applicable service manual procedures:

Steering system  $\rightarrow$  Motor driven power steering  $\rightarrow$  Steering gear box  $\rightarrow$  Repair procedures.

## NOTICE

To prevent potential damage to the clock spring, lock the steering wheel in place before removing the steering gear box assembly.

Disconnect the power pack connectors (A).

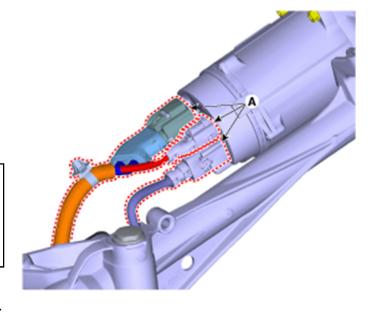

TSB #: 21-ST-001H Page 6 of 9


 Loosen and remove the power pack mounting bolts. Remove the power pack (A).

#### **Torque Specifications (For Mando):**

lb-ft	•10.3 - 11.8
kgf.m	•1.43 - 1.63
N.m	•14 - 16

# **NOTICE**


Inspect the power pack mounting bolt threads for wear or damage. If worn or damaged, replace the bolt with a new one.

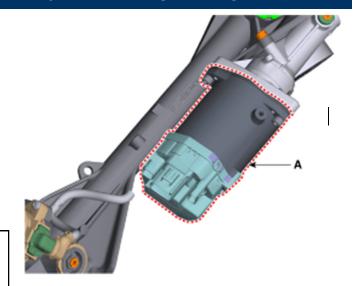


- 3. Apply grease to the serrated gear area of the power pack according to the instructions below.
  - Grease specification: Multemp MM-V
    Application quantity: 0.7~1.2g (50mm)



Apply grease to the serrated areas using a clean screwdriver or similar tool.

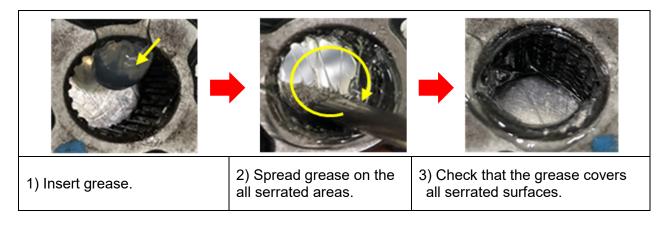

TSB #: 21-ST-001H Page 7 of 9

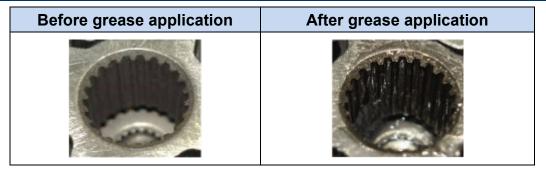


- If replacing the short gear assembly, transfer the removed power pack onto the new short gear assembly.
  - If replacing the power pack, install the new power pack onto the short gear assembly.

## **NOTICE**

When installing the power pack onto the short gear assembly, carefully align the coupler properly before tightening the mounting bolts.

- 5. Install the steering gear box assembly onto the vehicle. Install all parts in reverse order of removal.
- 6. Using the GDS, perform the following functions in the Motor Driven Power Steering system:
  - Steering Angle Sensor (SAS) calibration
  - EPS Type Recognition

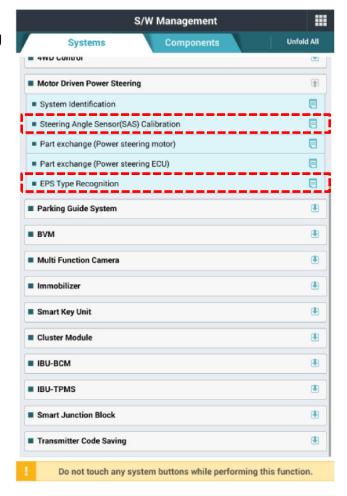


7. The service procedure is now complete.


TSB #: 21-ST-001H Page 8 of 9

### **Lead Wire Replacement**

1. Disconnect the power pack connectors (A).

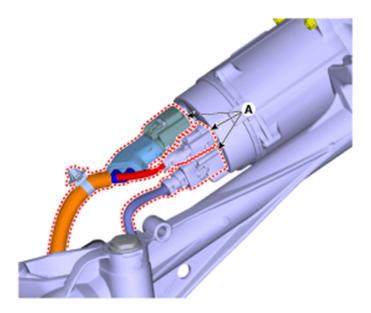

2. Remove the mounting clip (A), then replace the lead wire.

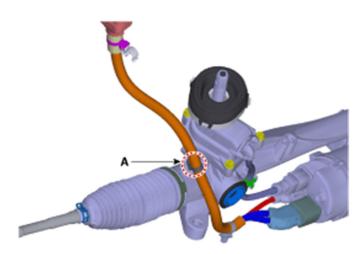

TSB #: 21-ST-001H Page 9 of 9