



Service Bulletin

Bulletin No.: 21-NA-010

Date: January, 2021

TECHNICAL

Subject: Engine Runs Rough, Malfunction Indicator Lamp (MIL) Illuminated - DTC's P0132, P0137, P0152 and/or P0157 Set

This bulletin replaces PIP5644. Please discard PIP5644.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2015	2018	All	All	6.2L L86	All
Chevrolet	Silverado	2014	2018	All	All	4.3L 5.3L 6.2L L83 L86 LV3	All
Chevrolet	Suburban	2015	2018	All	All	5.3L 6.2L L83 L86	All
Chevrolet	Tahoe	2015	2018	All	All	5.3L 6.2L L83 L86	All
GMC	Sierra	2014	2018	All	All	4.3L 5.3L 6.2L L83 L86 LV3	All
GMC	Yukon Models	2015	2018	All	All	5.3L 6.2L L83 L86	All

Involved Region or Country	North America, Europe, Russia, Israel, Palestine, Middle East, Chile, Columbia, Ecuador, Peru, Japan, S. Korea and Thailand.
Condition	<p>Some customers may comment that the MIL is illuminated and/or vehicle runs rough. This condition will occur within the first 5 minutes after the vehicle is started.</p> <p>Some technicians may find one or more of the following DTCs set in the Engine Control Module (ECM):</p> <ul style="list-style-type: none">• P0132• P0137• P0152• P0157
Cause	<p>Note: All 4 DTCs must be in history for this bulletin to apply.</p> <p>This condition may be caused by a software anomaly that allows all four DTC's P0132, P0137, P0152, P0157 to set.</p>
Correction	<p>If you experience the condition as described above, evaluate the vehicle for any other concerns.</p> <p>If no other concerns are found and you have the concern noted above, it will be necessary to clear the codes and release the vehicle to customer.</p> <p>⇒ In the event that the customer returns with all 4 DTC's set a second time, replace the Engine Control Module.</p>

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4086988*	Check and Clear Codes	0.3 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released January 22, 2021

