

Complaint - Front Seat Ventilation Does Not Function: Observe Specified Procedure (223/20)

Model Line: **Taycan (Y1A)**

Model Year: **As of 2020**

Equipment: **Seat ventilation (I-no. 4D3)
Seat ventilation/massage seat(s), front (I-no. 4D5)**

Concerns: **Front seat ventilation**

Information: Seat ventilation on driver side and/or passenger side does not function.
This may be due to a disconnected electric plug connection on the seat ventilation system, which is unlocked when the seat is moved. Contact is then interrupted in the electric plug connection.

Action required: Connect and lock electric plug connections for front seat ventilation as well as securing them with a tie-wrap.

Parts required

Parts Info:	Part No.	Designation	Qty.
	N 10623201	⇒ Tie-wrap	2 ea.

Component information

Plug connections for front seat ventilation

- 1 – Plug connection for front seat ventilation on driver side
- 2 – Plug connection for front seat ventilation on passenger side

Fastening electric plug connections for front seat ventilation**Information**

The fastening is described for one side as an example. The fastening on the other side is nearly identical and must be carried out in the same way.

Work
Procedure:



Electric plug connection for front seat ventilation

- 1 Connect and lock electric plug connection for front seat ventilation ⇒ *Electric plug connection for front seat ventilation -1-* and check that it is seated correctly.
- 2 Position tie-wraps ⇒ *Electric plug connection for front seat ventilation -2-* between the lines at both ends of the connectors and tighten them.



Information

If the electric plug connection is a four-pin connector, fasten the tie-wraps between the two lines on the right.

- 3 Cut off end piece of the ⇒ *Electric plug connection for front seat ventilation -2-* tie-wraps.

Invoicing

For documentation and warranty invoicing, enter the labor operations, PQIS coding and parts specified below in the warranty claim:

APOS	Labor operation	I No.
74094141	Repairing front left seat cushion fan	
74094142	Repairing front right seat cushion fan	

PQIS coding:

Location (FES5)	74090	Front seat cushion fan
Damage type (SA4)	1611	does not function

Parts Info:	Part No.	Designation	Qty.
	N 10623201	Tie-wrap	2 ea.

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2021 Porsche Cars North America, Inc.