



Ferrari North America

Technical Information

Date: February 2021
Bulletin #: 2728
Campaign #: 464
Supersedes:
Section: 9

Model: **Ferrari** *Roma*

Subject: Exhaust Terminal Grills Replacement

Please note that, it is necessary to replace the exhaust terminal grills integrated in the rear bumper, on vehicles of the aforementioned model from VIN No. 248641 to VIN No. 262358.

The list of these vehicles is available directly from the **New Modis** portal, by selecting the section "**Recall and Service Campaign Management**" and entering the campaign number indicated.


Procedure

For the execution of the intervention it is necessary to order the following components from our Spare Parts Service, according to your needs and vehicle specifications:

Terminal Grills Kit	Code	Quantity
TERMINALGRILL KIT - CHROME	70005390	1
TERMINALGRILL KIT - MATTE ALUMINIUM	70005362	1
TERMINALGRILL KIT - MATTE BLACK	70005367	1

Exhaust terminal grills replacement

- Remove the rear bumper (as described in paragraph E3.05 of the **Workshop Manual**).
- The exhaust terminal grills (A) are highlighted in **green** on the inside of the rear bumper – Fig.1;

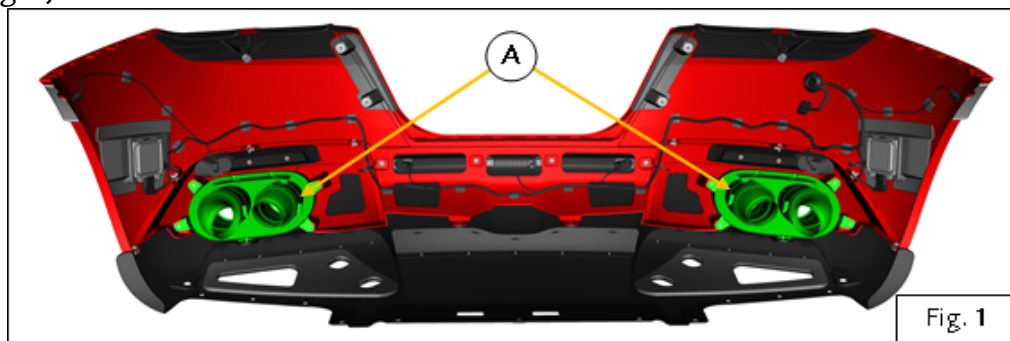



Ferrari North America

- Unscrew the indicated torx screws (A), 4 for each side, and the flanged nut in the lower central part (B) – Fig.2;



- Remove the right and left exhaust terminal grills – Fig. 3;




- Install the new exhaust terminal grills with 4 torx screws (A) for each side. Tighten at a torque of 5 Nm class C – Fig. 4.





Ferrari North America

- Tight the M5 flanged nut (B) at a torque of 3 Nm Class C.

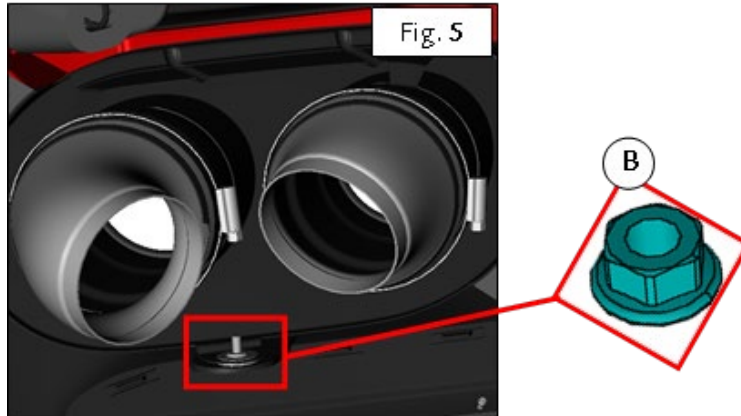

- Reinstall the rear bumper (as described in paragraph E3.05 of the **Workshop Manual**). During reassembly, make sure that the exhaust system pipes are perfectly centered and aligned with the pipes of the exhaust terminal grills.

- IMPORTANT -

The replaced parts must be returned by you through the Parts Return process. In case of failure to ship the old component, the claim will be rejected.

Services under warranty

The costs incurred for this service must be claimed through our **Warranty System** indicating:

› Campaign number.....	464
› Cost code	23
› Malfunction code	6909000351
› Problem code	01
› Operation code	69090003510
› Time	1.80 hours

Thank you for your co-operation.