

**SSM 49519 - 2020-2021 Explorer - 10R60/10R80-MHT Transmission -
Illuminated MIL With DTCs U0100, U0155, P166B, P0929, And/Or P0919 -
Built On Or Before 29-Oct-2020**

Some 2020-2021 Explorer vehicles equipped with a 10R60/10R80-MHT automatic transmission and built on or before 29-Oct-2020 may exhibit an illuminated malfunction indicator lamp (MIL) and diagnostic trouble codes (DTCs) U0100, U0155, P166B, P0929, and/or P0919. The vehicle may also exhibit an illuminated powertrain malfunction (wrench) indicator lamp. This may be due to the software in the gear shift module (GSM). To correct the condition, reprogram the GSM using the latest software level of the appropriate Ford diagnostic scan tool. For claiming, use causal part 7P155 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES

2020 - 2021 CAR: TW U625N EXPLORER

2020 - 2021 CAR: TW U625N EXPLORER