



Technical Service Bulletin

*****Attention this is not a recall*****

Please read the entire Bulletin before proceeding with any work. Contact Rosenbauer America if there are any concerns with information contained in this document.

Subject: Heat Pan Clearance

Applies To: All Rosenbauer and Commercial Chassis with a Diesel Particle Filter/Selective Catalytic Reduction system.

Condition: Exhaust system components have minimum clearance requirements around them that must be met to prevent critical component damage. Sealing a heat pan with smaller than required clearances can have adverse effects on these components from high exhaust system temperatures that may exceed manufacturer limits.

Correction: These are the guidelines to help avoid overheating of critical components and allowing enough room for **chassis** driveline components to function properly.

- 1" minimum clearance all the way around the aftertreatment.
- 1" minimum clearance all the way around the exhaust pipe.
- ¾" minimum clearance all the way around the driveline and driveline components.
- Pictures are on the next page.

Tools Needed: Die grinder, jig saw, hole saw, and a deburring tool.

Amount of Time to Rework: 15 minutes for inspection, 2-4 hours for rework depending on the size.

Contact Info: contact recalls@rosenbaueramerica.com or the phone numbers at the bottom of the page.

www.rosenbaueramerica.com


recalls@rosenbaueramerica.com

ROSENBAUER SOUTH DAKOTA, LLC.
100 THIRD STREET
LYONS, SOUTH DAKOTA 57041
P: 605.543.5591

ROSENBAUER MINNESOTA, LLC.
5181 260TH STREET
P.O. BOX 549
WYOMING, MINNESOTA 55092
P: 651.462.1000

ROSENBAUER MOTORS, LLC.
5190 260TH STREET
P.O. BOX 549
WYOMING, MINNESOTA 55092
P: 651.462.1000

ROSENBAUER AERIALS, LLC.
870 SOUTH BROAD STREET
FREMONT, NEBRASKA 68025
P: 402.721.7622

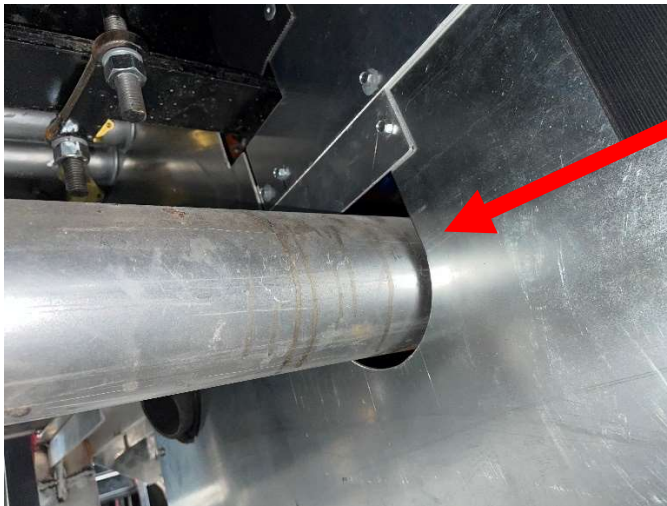

1" MINIMUM GAP AROUND THE
EXHAUST PIPE

3/4" MINIMUM GAP AROUND THE
ENTIRE DRIVELINE AND ALL OF ITS
COMPONENTS

1" MINIMUM GAP ALL THE WAY
AROUND THE AFTERTREATMENT

