



SERVICE BULLETIN

Classification: EC20-023A	Reference: NTB20-083A	Date: February 19, 2021
------------------------------	--------------------------	----------------------------

2019-2020 ALTIMA; DTC P2015 OR P2004 STORED DURING COLD WEATHER

This bulletin has been amended. See **AMENDMENT HISTORY** on the last page.
Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2019-2020 Altima (L34)
APPLIED ENGINE: PR25DD

IF YOU CONFIRM

The customer stated that the MIL was on after starting the engine in cold weather, below 0°F.

And

DTC P2015 (INTAKE MANIFOLD RUNNER CONTROL VALVE POSITION SENSOR) and/or DTC P2004 (INTAKE MANIFOLD RUNNER CONTROL VALVE) are stored in the ECM. DTC status is either current or past.

And

No problem is found after performing the DTC diagnosis per the Electronic Service Manual (ESM).

ACTION

Replace the intake manifold.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Replace the intake manifold.

- For intake manifold replacement, refer to the ESM section: **ENGINE > ENGINE MECHANICAL > PR25DD > REMOVAL AND INSTALLATION > INTAKE MANIFOLD.**

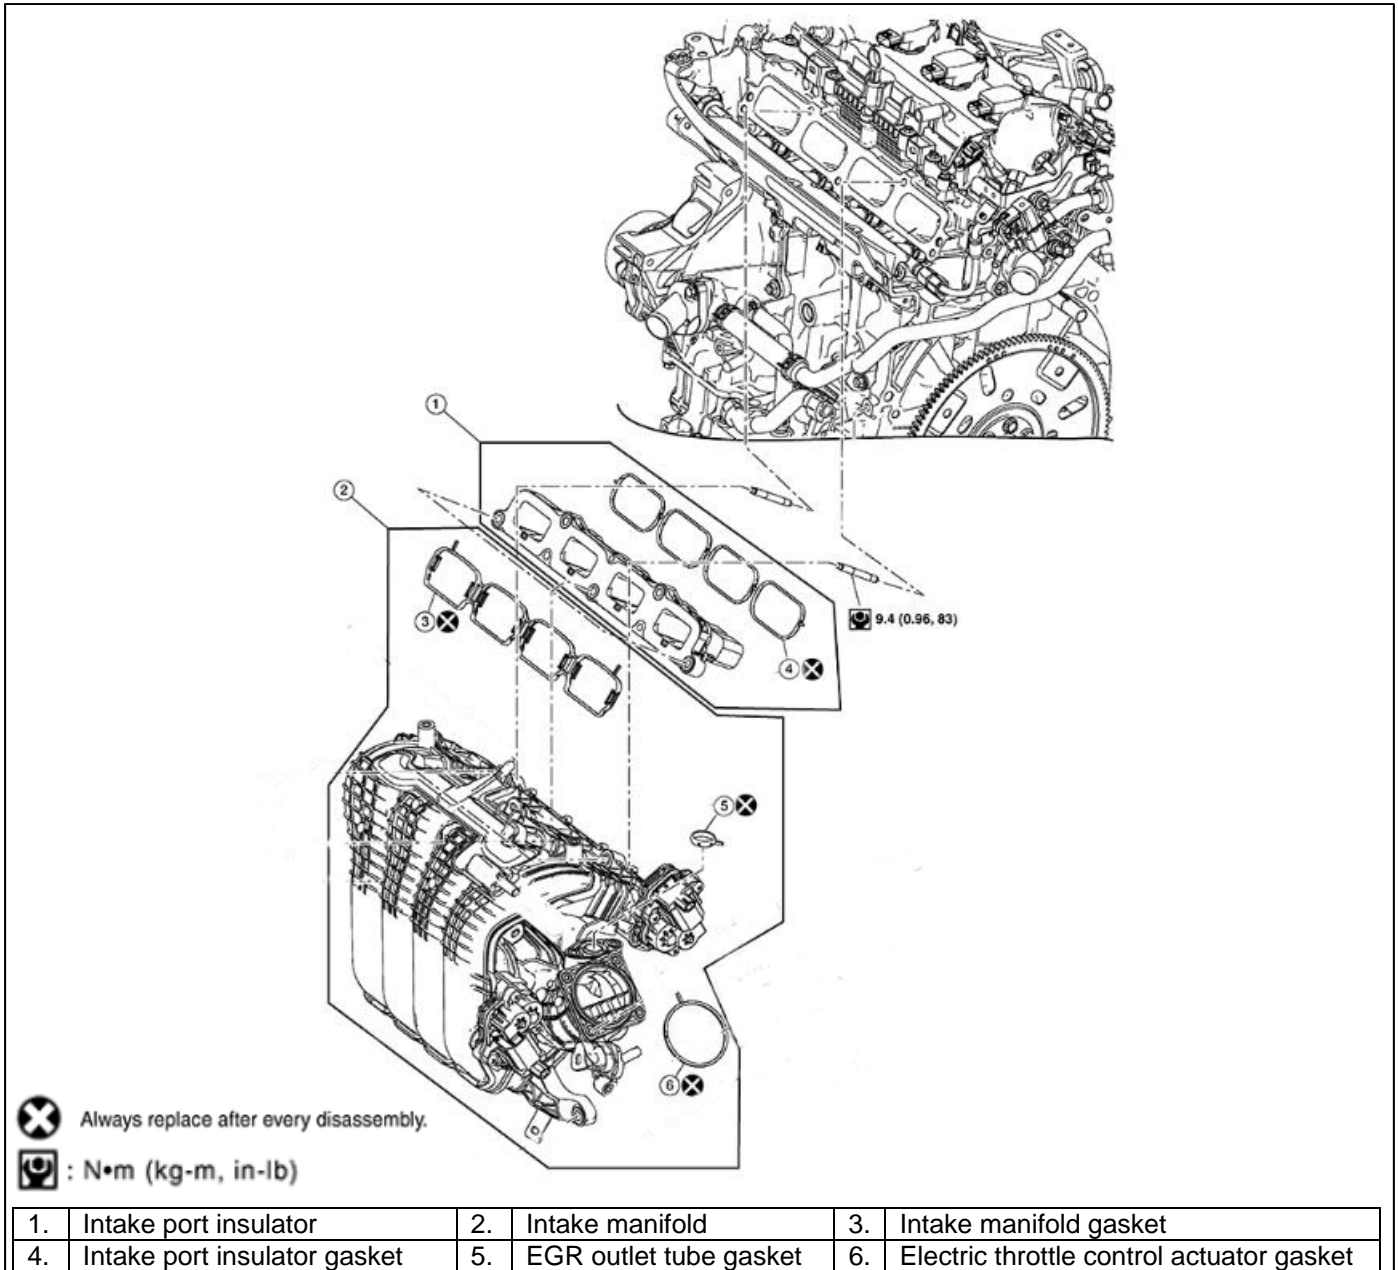


Figure 1

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
INTAKE MANIFOLD	14001-6CA0C	1
GASKET – INTAKE MANIFOLD (1)	14035-6CA0A	1
INSULATOR ASSY – INTAKE PORT (1)	110D0-6CA0A	1
GASKET (1)	110D2-6CA0A	1
GASKET – EGR GUIDE TUBE (1)	14722-6CA0A	1
GASKET – INTAKE ADAPTER (1)	16175-6CA0A	1

(1) Single-use part.

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Intake Manifold and Gasket	(1)	AR10AA	ZE	32	(2)

- (1) Reference the electronic parts catalog and use the Intake Manifold Assembly (14001-*****) as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (FRT).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
November 24, 2020	NTB20-083	Original bulletin published
February 19, 2021	NTB20-083A	PARTS INFORMATION revised