



Technical Service Bulletin

10 Oil is lost from the filler cap

10 21 21 2059446/4 March 8, 2021. Supersedes Technical Service Bulletin Group 10 number 20-20 dated October 29, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5, SQ5	2017	All	3.0 TFSI
Q5, SQ5	2018	000001 - 212605	3.0 TFSI
A4, A5, A5 Sportback, A5 Cabriolet, A6, A7, A8, RS5, RS5 Cabriolet, RS6, RS7, S4, S5 Cabriolet, S6, S7, S8, Q7, and SQ7	2017 - 2018	All	3.0 TFSI
A4, S4	2019	000001 - 056412	3.0 TFSI
A5, A5 Sportback, A5 Cabriolet, RS5, RS5 Cabriolet, and S5 Cabriolet	2019	000001 - 027694	3.0 TFSI
A6, A7, S6, and S7	2019	000001 - 118457	3.0 TFSI
A8, S8	2019	000001 - 011487	3.0 TFSI
Q7, SQ7	2019	000001 - 004275	3.0 TFSI

Condition

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised <i>Warranty</i> (Updated Labor Operations)
3	11/03/2020	Revised <i>Service</i> (Added photo and description)



Technical Service Bulletin

2	07/14/2020	Revised header (Corrected Elsa display issue)
---	------------	---

Customer states:

- There is oil found in the engine compartment, front end, and around the filler cap.
- There is a smell coming from the engine compartment.

Workshop findings:

- There are traces of oil around the filler cap.

Technical Background

A faulty membrane in the breather line can result in excess pressure in the crankcase and therefore some oil is lost through the filler cap.

Production Solution

A breather line with an improved membrane has been implemented in production.

Service

Replace the breather line (different variants available, only order by VIN) by following the Elsa repair manual (Figures 1 and 2).



Figure 1. Breather line for the Turbocharged V6.



Technical Service Bulletin

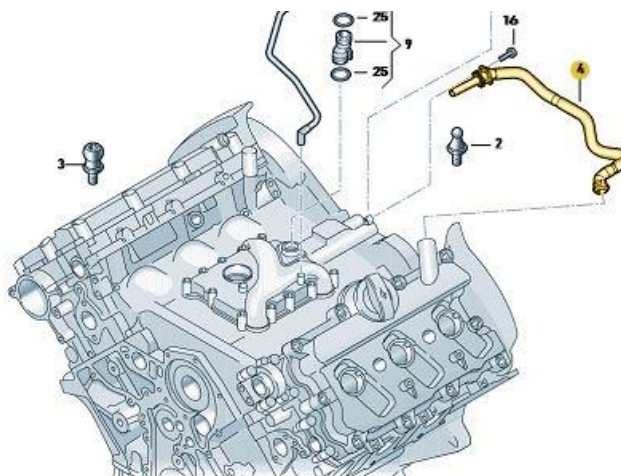


Figure 2. Breather line for the Supercharged V6 (EVO).

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	1050		
Damage Code:	0050		
Labor Operations:	Remove + install crankcase breather hose	1052 1993 (Turbo V6) Or 1052 1943 (Q8 only)	See SRT with associated operations
	Remove + install crankcase breather hose	1052 1999 (EVO)	30 TU
	Clean (If required)	1052 2999	5 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU



Technical Service Bulletin

Claim Comment:	As per TSB #2059446/4
-----------------------	-----------------------

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
Order by VIN	Breather Line	01

Additional Information

All parts and service references provided in this TSB (2059446) are subject to change and/or removal.

©2021 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.