

---

PuMA measure

## Malfunction indicator lamp after ABS control unit replacement

US 65505991-01 - 02/02/21

### Complaint:

After replacement of the ABS control unit, the malfunction indicator lamp in the instrument cluster lights up and the DME stores the following fault memory: 0x0027ED DME: No CAN message  
In addition, the changeover riding mode no longer works.

---

### Cause

The newly-installed ABS control unit has an incorrect software version.

---

### Measure

The correct software version must be programmed on the newly-installed ABS control unit by means of an IRAP / remote session: [remotesupport@bmw-motorrad.com](mailto:remotesupport@bmw-motorrad.com)

---

### Validity information

Model series:	[K46]
Engine range:	[ALL]
Body style:	[ALL]
Fault codes:	[27ED]
Production period:	from 01/09/09 up to 31/08/11

---

### Repair overviews

34/52/004/33101, ABS control unit, Cannot be encoded with VFC, , Cannot be encoded with VFC, , Program/encode