	GROUP ELE	MODEL 2011-2014MY Sedona (VQ) w/PSD
	NUMBER 232	DATE March 2020
<b>TECHNICAL SERVICE BULLETIN</b>		
<b>SUBJECT: POWER SLIDING DOOR (PSD) OPERATION INSPECTION AND REPAIR</b>		

This bulletin provides information regarding the replacement of certain Power Sliding Door (PSD) system parts associated with the 'Warranty Extension Program' (WTY018) on some 2011-2014MY Sedona (VQ) vehicles produced from April 1, 2010 through April 4, 2014. The power sliding door may not completely latch upon closing in auto-mode. If this occurs, the open-door indicators such as activation of the chimes and illumination of the dashboard telltales and/or dome lights will occur. Inspect and diagnose the power sliding door function to identify the part requiring replacement.

**Note:** The PSD features a '2-stage latching mechanism'. In stage one (1), the door may appear to be fully closed (1st latching), however, only in stage two (2), the PSD will actually be fully closed/secured (2nd latching).




Printed TSB copy is for reference only; information may be updated at any time.  
Always refer to KGIS for the latest information.

- 
- Circulate To:**
 General Manager
  Service Manager
  Parts Manager  
 Service Advisors
  Technicians
  Body Shop Manager
  Fleet Repair

**Inspection and Replacement Procedure:****❗ IMPORTANT**


**The power sliding door features a 2-stage latching mechanism.** In stage one (1), the door may appear to be fully closed/secured (latch 1), however, only in stage two (2), the power sliding door will actually be fully closed/secured (latch 2).

- 1a. The PSD (Left or Right Side) will not closed fully and/or is secured on the 2nd stage latching after closing in auto-mode.
- 1b. **Repeat closing of the PSD in auto-mode after four warning alerts.**
- 2a. **Do not replace the PSD drive unit/motor (A),** instead it is recommended that if the **PSD does NOT close normally,** proceed to diagnose by referring to the shop manual on KGIS to replace the Rear Door Latch Assembly or Rear Door Actuator.

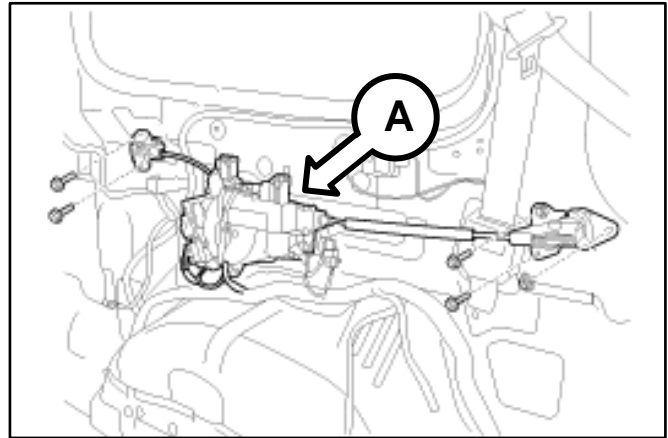


- 2b. Replace the Rear Door Latch Assembly (B) or Rear Door Actuator (C) as needed.

**Note:** Check if the PSD latch is fixed (Hold Open Lock) at the back when the door fully opens.

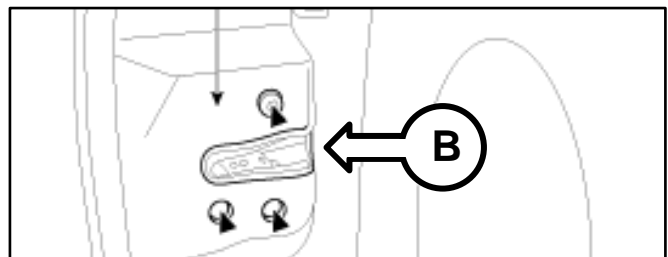

Replace the PSD rear door latch assembly (B) by referring to the “Body (Interior Exterior) → Exterior → Rear Door → Repair procedures” chapter in the applicable Shop Manual on KGIS.

Replace the PSD rear door actuator (aka Remote Controller) (B) by referring to the “Body (Interior Exterior) → Exterior → Rear Door → Repair procedures” chapter in the applicable Shop Manual on KGIS.

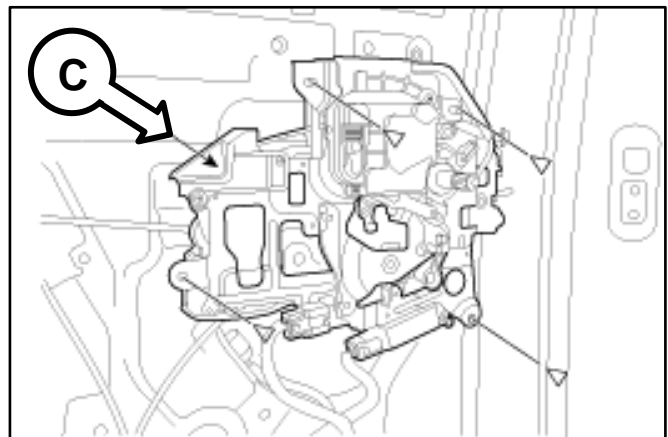





SUBJECT:

## POWER SLIDING DOOR (PSD) OPERATION INSPECTION AND REPAIR

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sedona (VQ)	April 1, 2010 to April 4, 2014

REQUIRED PART:

Part Name	Part Number	Figure	Qty.	Comment
PSD Rear Door Remote Controller	81440 4D513FFF		1	LH
	81450 4D513FFF			RH
PSD Rear Door Latch Assy.	81410 4D010FFF		1	LH
	81420 4D010FFF			RH

WARRANTY INFORMATION:

**N Code: I22 C Code: ZZ3**

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	81440 4D513	0	PSD Inspection	83801F03	0.3 M/H	N/A	0
			PSD Rear Door Remote Controller Replacement (One Side)	81440F01	0.5 M/H	81440 4D513FFF or 81450 4D513FFF	1
			PSD Rear Door Remote Controller Replacement (Both Sides)	81440F02	0.8 M/H	81440 4D513FFF 81450 4D513FFF	1
			PSD Latch Assembly Replacement (One Side)	81410F04	0.6 M/H	81410 4D010FFF or 81420 4D010FFF	1
			PSD Latch Assembly Replacement (Both Sides)	81410F05	1.0 M/H	81410 4D010FFF 81420 4D010FFF	1

