

Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: McLaren Speedtail

Location: N/A

Topic: Please read below some of known limitations of Speedtail, investigation and where possible countermeasures will be included in the next software platform release. If you have any specific questions please raise them via a Technical Request.

Condition: Permanent

Diagnostic Trouble Codes

N/A

Measure

Instrument Cluster

- "Battery critically low" message may be displayed on the IC during wake-up even though battery voltage is good
- USB port: Vehicles with a part installed with a blanking plate, do not have functionality available. This part is to be replaced via a campaign in due course to allow usage. Vehicles which have a phone icon next to the USB-C connection have the latest part already and can be used
- English is the only supported language
- With current software the fuel gauge may not show actual fuel level straight away drive vehicle or wait for correct level
- With current software the 12v battery available parking days will show 33 days when fully charged but the gauge will only be $\frac{3}{4}$ full

Infotainment System

- USB port: Currently is not available, pending certification approval
- Radio: AM/FM radio functionality is not fitted
- Phone: Signal bar displayed is one less than displayed on the phone

- Bluetooth Media: In Playlist, the currently playing music is not present (it is available from browse all songs)
- Bluetooth Media: Repeat and shuffle are not operating from ADI but are available from the phone device
- Bluetooth Media: Not possible to answer incoming calls through WhatsApp from the displays (only the red phone button is displayed not the green one when receiving the incoming call notification)
- The rear view camera can be turned on during forward driving up to 30kph via the Instrument cluster menu
- Ambient Lighting icon on the ADI display changes colour to match colour selected

Powertrain

- Velocity mode is the slowest mode you can drive in up to 200mph then power is 1050ps, traction control is also off
- Comfort mode - 800ps
- Sport - 1050ps hybrid deployment in full, will not be possible to reach top speed

Body and interior

- Glovebox operation - **push not pull** (similar to fuel filler flap), otherwise the latch will break.
- Door card - do not grab door card to close the door
- Door manual movement - advise not to or will require a reset - fully open and then fully close. It is a powered door system so if manually operated will need to operate to end stops and do a sleep cycle
- Drivers seat is supplied at maximum height as standard, there are spacers that can be removed to lower the driver's seat height

Pre-Delivery Inspection (PDI) Key Points

- Some of the accessories will not be in the sealed bag
 - Warning triangle and towing eye are located under the false floor of the rear luggage bin
 - The fire extinguisher, first aid kit and tyre inflation kit are located in the front luggage bin behind removable panel
 - The titanium tool kit and customer owner's manual will be delivered separately along with the wireless charger

- The wireless charger needs to be set up in the workshop during PDI before first use. Follow the instructions supplied with the charger, update the application before use
- Ensure the vehicle is not in lift when checking the Power Steering fluid level
- When setting the time and date use the GPS sync and then select the correct time zone
- Valet Pin is already set 0000 so no need to adjust this
- Check the function of all the electrochromic glass zone using the Ambience Menu
- Ignore item "Preset local radio stations and check operation of all speakers" on the PDI sheet as radio is not available
- The fuel and oil filler flaps have a built-in time out for the motor please allow 5 seconds between presses of the flaps, car needs to be awake for latch to be open.

Wireless Charging System

- Install the wireless charger as described in the installation manual.
- The wall box must be mounted vertically preferably on a wall.
- When connecting the display (tablet) to the wall box, use the last 4 characters of the base pad serial number (i.e "-123")
- If you are unable to use the wireless charger system the car needs to be connected to the supplied trickle charger via the 12v socket in the front luggage bin
- If the 12v battery goes flat the wireless charger will not be able to recover the battery, the 12v battery will need to be accessed and charged

Parts Information

N/A

KA Update Information

02/03/2021 - V2 released

18/03/2020 - Initial release

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.