Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:

RUSTY PANEL AT BOTTOM (INNER SIDE) OF DOORS

Bulletin No.: 09-009/21

Last Issued: 03/11/2021

APPLICABLE MODEL(S)/VINS 2017-2021 CX-5

2016-2021 CX-9

DESCRIPTION

Some customers may complain about rust at the bottom (inner side) of the doors where the seaming welt is located. It is caused by mud/sand adhering to the side sill, which scratches the paint surface when the door is opened/closed. The mud/sand is most likely brought in by the driver and/or passenger when stepping in and out of the vehicle.

Page 1 of 6



Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

- 1. Verify the customer concern.
- 2. Repair the paint rust/blister damage on the affected door panel(s) according to normal bodyshop repair procedures.
- 3. After the paint repair has been completed, attach the protection film to the door panels according to steps a ~ f below.

NOTE: Attach the protective film to all (4) four door panels, even those without any paint rust/blister damage.

- a) Remove the door trim according to MGSS online:
 - CX-5: FRONT DOOR TRIM REMOVAL/INSTALLATION
 - CX-5: REAR DOOR TRIM REMOVAL/INSTALLATION
 - CX-9: FRONT DOOR TRIM REMOVAL/INSTALLATION
 - CX-9: REAR DOOR TRIM REMOVAL/INSTALLATION

Page 2 of 6

- b) Using a clean cloth, clean the door panel where the film will be attached using isopropyl alcohol or equivalent. Make sure to remove all dust and grease.
- c) Spray the door panel surface with isopropyl alcohol diluted in water.


NOTE: Water will make it easier to properly position the film.

- d) Cut the protection film to the necessary dimensions (shown below).
- e) Remove the backing from the film and attach it to the door panel as shown below.
- f) Run a spatula or equivalent tool over the film to ensure proper adhesion, squeezing out the air bubbles. Make sure that edges of film are not turned over.

NOTE: Remaining air bubbles with a diameter of 3mm or smaller is okay.


CX-5 - Front Door (RH door shown):


- Cut the protection film to 350mm x 30mm.
- Starting from the corner (1) at the front side of the vehicle (2), apply the film.
- Vertically align the bottom of the protection film to the corner (3) where the round shape changes to straight.

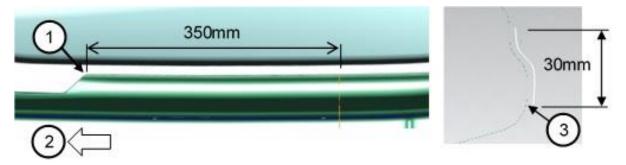

CX-5 - Rear Door (RH door shown):

- Cut the protection film to 190mm x 30mm.
- Starting from the corner (1) at the front side of the vehicle (2), apply the film.
- Vertically align the bottom of the protection film to the corner (3) where the round shape changes to straight.

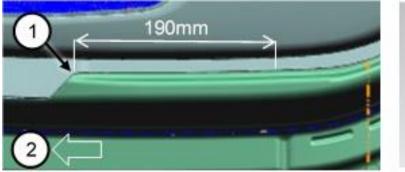


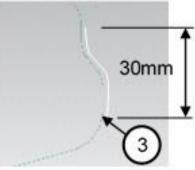

Page 3 of 6


CX-9 - Front Door (RH door shown):

- Cut the protection film to 350mm x 30mm.
- Starting from the corner (1) at the front side of the vehicle (2), apply the film.
- Vertically align the bottom of the protection film to the corner (3) where the round shape changes to straight.

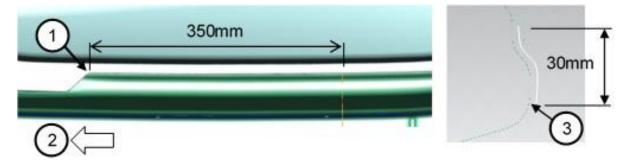

CX-9 - Rear Door (RH door shown):

- Cut the protection film to 330mm x 30mm.
- Starting from the corner (1) at the front side of the vehicle (2), apply the film.
- Vertically align the bottom of the protection film to the corner (3) where the round shape changes to straight.

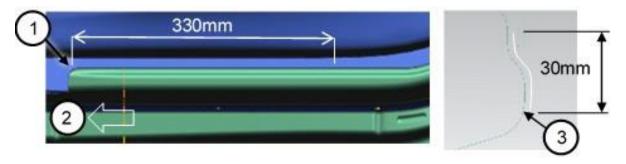

- 4. Reinstall the door trim according to MGSS online:
 - CX-5: FRONT DOOR TRIM REMOVAL/INSTALLATION
 - CX-5: REAR DOOR TRIM REMOVAL/INSTALLATION
 - CX-9: FRONT DOOR TRIM REMOVAL/INSTALLATION
 - CX-9: REAR DOOR TRIM REMOVAL/INSTALLATION
- 5. Verify the repair.

PARTS INFORMATION

Page 4 of 6

Bulletin No.: 09-009/21	Last Issued: 03/11/2021

Parts Number	Description	Qty.	Notes
BAYE-51-W22	PROTECTION FILM	2	500 mm x 65 mm

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
 - This repair will be covered under Mazda's New Vehicle Limited Warranty term.
 - Additional diagnostic time cannot be claimed for this repair.

NOTE: Attach the protective film to all (4) four door panels, even those without any paint rust/blister/corrosion damage.

Warranty Type	А
Symptom Code	53
Damage Code	9Y
Part Number Main Cause	5555-RS-001
Quantity	0
	 Protection Film, Attach (all four doors) XXS8WERX / 1.1 Hrs. Paint, Rust, Corrosion Repair XXS8WXPT / Enter actual time. (Max. 6.8 Hrs. for all four doors)
Operation Number / Labor Hours:	NOTE:
	 If the paint repair is performed by outside bodyshop, enter 0.0 hours then claim the actual sublet cost using the sublet code "A2". If the sublet amount is over \$1000, it is required that photos of all 4 doors be submitted, along with the sublet repair estimate for warranty preauthorization,

Page 5 of 6

Bulletin No.: 09-009/21	Last Issued: 03/11/2021

NOTE: Enter "Protection Film" with the quantity "2" as related parts.

Page 6 of 6