

DTNA Solutions > Discussions and Feedback > Tech Talk
> scr conversion codes only when bobtailing



Engines_Service
Apprentice

02-12-2021 08:11 AM

scr conversion codes only when bobtailing

anyone have dd15 causing scr codes while bobtailing, yet no problems with a load, customer also complains about engine temps lower when bobtailing? vin ku7344
Alan Arlette

Labels :

EngineTransmission Cooling | and HVAC

Freightliner

New Cascadia

Add tags



2 Kudos

Reply



Scott_Trippel
Gear Head

02-12-2021 10:08 AM

These things can have conversion faults in different duty cycles.
What have you found when troubleshooting the code.

What does the log file show when in bobtail mode, specifically what is the inlet and outlet nox values. I am sure this is where you will need to start.

Add tags



2 Kudos

[Reply](#)**Steve_Reppard**

Piston Head

02-16-2021 08:03 AM

What t/s have you done with results? These conversion codes can be very complexed so to be of any help we need to know details.

[Add tags](#)

1 Kudo

[Reply](#)**Engines_Service**

Apprentice

03-08-2021 05:16 AM

installing a winter front helped alot with nox conversion, but we still get 4364/17 ever once and a while, checked for biased nox sensors=ok def strength=ok def dosing at 125 ml, run scr efficiency test code clears and conversion very good above 90, how can i tell if unit is going into bobtail mode? seems like the truck isnt working hard enough

thx for the help guys

Alan Arlette

[Add tags](#)

0 Kudos

[Reply](#)

