

# Technical product information

<b>Topic</b>	Driver/Passenger door/s power latch creak on close
<b>Market area</b>	India (5IN),Kenia (5KE),Russische Föderation (5RU),Südafrika (5ZA),Australia E04 Bentley rest Asia and Australia (6E04),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)
<b>Brand</b>	Bentley
<b>Transaction No.</b>	2061582/2
<b>Level</b>	EH
<b>Status</b>	Approval
<b>Release date</b>	

## New customer code

Object of complaint	Complaint type	Position
body fixtures and fittings -> doors	noise, vibration	
body fixtures and fittings -> door, closures operation	functionality	
body fixtures and fittings -> door, closures operation -> close door	noise, vibration -> noise	

## New workshop code

Object of complaint	Complaint type	Position
body fixtures and fittings -> doors -> door power-latching motor	noise, vibration -> noise	right
body fixtures and fittings -> doors -> door power-latching motor	noise, vibration -> noise	left

# Vehicle data

## Bentayga

### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
4V1*	2021	E		*	*	*

# Documents

Document name
<a href="#">master.xml</a>

## Customer statement / workshop findings

Driver or Passenger door creak during the power latch "Close" function

## Technical background

**IMPORTANT:** Refer to the vehicle repair history – In the event that all four door latches have been replaced previously, only the individual/faulty latch should now be replaced (See example of door latch in Figure 1)

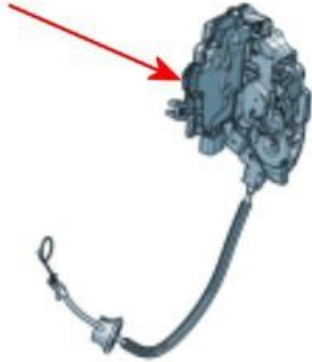


Figure 1

## Production change

-

## Measure

Ensure the fault is as described within the Customer statement, refer to the video on the Bentley Hub referencing TPI 2052394/-

*NOTE: The video shown on the Bentley Hub is for reference purposes only, the symptom is the same regardless of vehicle type shown*

1) Obtain a clear video recording of the issue from each individual affected door latch **NOTE:** Save each video as they will be required later within this procedure

**IMPORTANT:** Refer to the vehicle repair history - In the event that all four door latches have been replaced previously, only the individual/faulty door latch should now be replaced

2) Referring to the applicable Repair Group - Rep.Gr 57 (Front) or Rep.Gr 58 (Rear) - Replace one or all four door latches (as detailed in the Technical background section)

- Right hand front
- Left hand front
- Right hand rear
- Left hand rear

3) Open a Non technical/For information only DISSquery

- Attach the applicable videos to the open DISSquery
- Submit the DISSquery

## Warranty accounting instructions

Warranty Type 110 or 910

Damage Service Number 57 17

Damage Code 00 20

Time to replace x4 door latches

Labour

Labour operation code 57 17 56 00 (Use 99 index up to 04/02/21)

Time 170 Time units

Time to replace x1 door latch

Labour

Labour operation code 57 17 19 00

Time 40 Time units

## Parts information

Refer to the ETKA parts catalogue