



TECHNICAL TOPICS

BODY/CHASSIS



Water Leak from Windshield	17 - 20MY Discovery 15 - 19MY RR Evoque
<p>Customer Voice:</p> <ul style="list-style-type: none"> A customer may report a water leaking into the vehicle cabin from the windshield. <p>Technical Description:</p> <ul style="list-style-type: none"> The primer layer between the windshield and the PU adhesive may fail to seal in spots allowing water to enter the vehicle cabin. <p>Status:</p> <ul style="list-style-type: none"> SSM74710 has been published to request an EPQR only be submitted for vehicles built after L2442747. EPQRs are not needed for Discovery (L462) models built before L2442747 or any RR Evoque (L538) models. Pictures of the windshield and glass data are however, required to be attached to the warranty claim as stated in Aftersales Bulletin NAS20.07.003 The Workshop Manual windshield water ingress diagnostics section will be updated to reflect this. 	  <p style="text-align: center; font-size: small;">● - location & quantity of leak path from sample</p> 