

## TECHNICAL TOPICS

### POWERTRAIN



Flashing D After Using Remote Start	18MY - Onward RR, RR Sport PHEV only
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> <li>- The vehicle does not engage drive and will show a flashing D only after using remote start.</li> </ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> <li>- Torque monitoring incorrectly senses a fault due to a timing issue with the change of state from remote engine start to engine running and associated messaging.</li> <li>- DTC P061B-62 is stored in the PCM. TOPIx DTC Help Text instructs replacement of the PCM.</li> </ul> <p><u>Status:</u></p> <ul style="list-style-type: none"> <li>- Do not replace the PCM for this concern.</li> <li>- A revised PCM software is in development and is expected to be released in April 2021.</li> <li>- Reference <b>SSM 75298</b>. Normal communication channels of Pathfinder release notes, SFCC, etc. will be utilized to communicate the availability of this update.</li> </ul>	

