

## TECHNICAL TOPICS

### POWERTRAIN



#### PCM U0111-00 Lost Communication With Battery Energy Control Module "A"

19MY – Onward Range Rover, RR Sport, RR Evoque, Discovery Sport MHEV variant only

##### Technical Description:

- Following a PCM/EPICD/BECM combination update, the PCM stores 12652800 (U0111-00) and the BECM appears offline.

##### Status:

- Carefully inspect the 48V battery cables and connector for proper fit, terminal tension at the connector and proper seating. Correct any issues identified before proceeding.
- If the condition persists following a bus sleep, disconnect the 12V battery and allow the vehicle to sit for 10 minutes. Reconnect the battery and re-evaluate.
- If diagnostic support is required after all **TOPIX Workshop Manual DTC Help Text in the relevant section 100-00** steps and **Pathfinder Guided Diagnostics** have been completed, raise a TA.
- Any time a DTC is displayed as a number string and "Unknown DTC" description, please raise a Diagnostic EPQR so the Pathfinder team can update the software to ensure the DTC decoding is addressed.

