



# Preliminary Information

## PIP5776B Misfire Due To Collapsed Lifter

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2021	All	All	6.2 L87	All
Chevrolet	Silverado 1500 (New Model)	2019	All	All	5.3 L84 6.2 L87	All
Chevrolet	Silverado 1500	2020 - 2021	All	All	5.3 L84 6.2 L87	All
Chevrolet	Suburban	2021	All	All	5.3 L84 6.2 L87	All
Chevrolet	Tahoe	2021	All	All	5.3 L84 6.2 L87	All
GMC	Sierra 1500 (New Model)	2019	All	All	5.3 L84 6.2 L87	All
GMC	Sierra 1500	2020 - 2021	All	All	5.3 L84 6.2 L87	All
GMC	Yukon	2021	All	All	5.3 L84 6.2 L87	All

Involved Region or Country	North America, <b>Middle East</b>
Condition	The vehicle may come in with a P0300 - P0308 set with a bent push rod that leads to a Collapsed lifter or a lifter that come apart.
Cause	Internal lifter concern.

### Correction:

If SI leads to a collapsed lifter and/or lifter that have come apart, it is recommended to replace the lifter guide and the 4 lifters.

Mark the guide to show the location of the cylinder for inspection (please do not cover the date code).

The part will be requested back.

It is not necessary to replace the oil control solenoid.

### Warranty Information

For this repair use the published labor time as called out in SI Labor Time Guide.

### Version History

Version	3
Modified	01/20/2021 - Created on. 02/23/2021 - Added the Middle East 03/04/2021 - Updated to clairfy models.



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.