



Bulletin No.: PIP5683A
Published date: 03/9/2021

Preliminary Information

PIP5683A Whistle Or Squeak or Squeal Noise From The Engine

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer	2019 - 2020	All	All	3.6L LGX	All

Involved Region or Country North America

Condition Some customers may come in with a whistle, squeal, or squeak noise from the engine area.
This noise may get more noticeable after driving for a while.

Cause The cause of this noise may be plastic flashing restricting the clean air port on the air cleaner duct on top of the engine as shown below.
The restriction or flashing will appear that the hole is not drilled out completely and can be seen about 2 inches inside the tube.



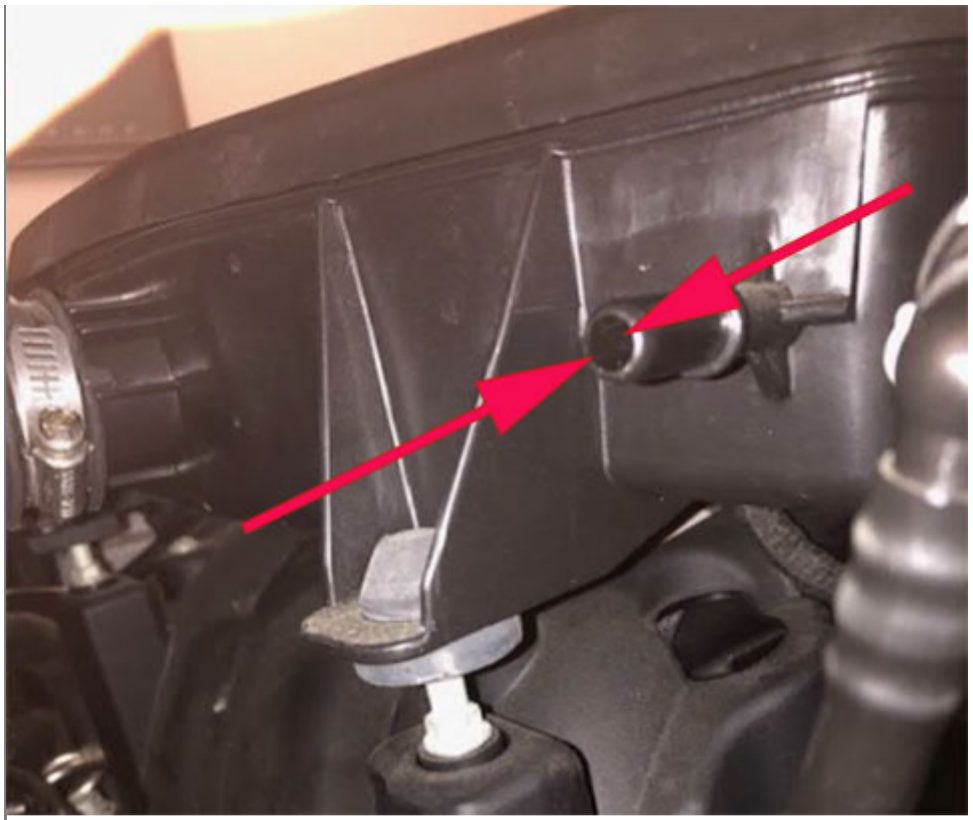

Correction:

To correct this condition, replace the air cleaner duct and reevaluate for a noise concern.

Make sure you run the engine long enough to build up crankcase pressure during testing to ensure correction.

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4020690	Air Cleaner Outlet Duct Replacement	Use Published Labor Time

Version History

Version	2
Modified	10/02/2019 - Created on 03/09/2021 - updated review date.



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.