



Preliminary Information

PIT5827 Airbag Warning Lamp Illuminated On Driver Information Center (DIC), DTC B0017 01 B0024 01 or B001E 01 Set

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT4	2021	All	All	All	All
Cadillac	XT5	2021	All	All	All	All
Cadillac	XT6	2021	All	All	All	All
Chevrolet	Blazer	2021	All	All	All	All
Chevrolet	Camaro	2021	All	All	All	All
Chevrolet	Malibu	2021	All	All	All	All
GMC	Acadia	2021	All	All	All	All

Involved Region or Country	North America
Condition	Customers may comment that the Airbag Warning Lamp illuminated on the Driver Information Center (DIC), or they got a notification from OnStar for an SIR concern with no lamps or messages. Technicians may find DTC B0017 01, B0024 01, or B001E 01 set.
Cause	The concern is the SDM software and SPS is planning to have an update with new software in July 2020.

Correction:

Verify the DTC B0017 01, B0024 01, or B001E 01 is in history and if diagnostics lead to replace the Knee air bag, Driver Seat Inboard Side air bag, or the SDM, then clear the code and verify the airbag warning light stays off and explain to the customer that an update will be available in July 2021.

This code is setting due to an internal SDM software concern. It does not effect the operation of the system.

Version History

Version	1
Modified	03/24/2021 - Created on.



GENERAL MOTORS