

Bulletin No.: PIP5712B Published date: 03/26/2021

Preliminary Information

PIP5712B Diagnostic Tip - Servicing Crankshaft Balancer and Cam Drive System Components

Models


Brand:	Model:	Model Years:	VIN:		Facina	Transmissions
			from	to	Engine:	Transmissions:
Buick	Encore GX	2020 - 2021	All	All	1.3L (LIH) 1.3L (L3T)	All
Buick	Envision	2021	All	All	2.0L (LSY)	All
Cadillac	CT4	2020 - 2021	All	All	2.0L (LSY) 2.7L (L3B)	All
Cadillac	СТ5	2020 - 2021	All	All	2.0L (LSY)	All
Cadillac	СТ6	2019	All	All	2.0L (LSY)	All
Cadillac	XT4	2019 - 2021	All	All	2.0L (LSY)	All
Cadillac	XT5	2020 - 2021	All	All	2.0L (LSY)	All
Cadillac	XT6	2020 - 2021	All	All	2.0L (LSY)	All
Chevrolet	Blazer	2020 - 2021	All	All	2.0L (LSY)	All
Chevrolet	Silverado	2019 - 2021	All	All	2.7L (L3B)	All
Chevrolet	Trailblazer	2021	All	All	1.3L (LIH) 1.3L (L3T)	All
GMC	Acadia	2020 - 2021	All	All	2.0L (LSY)	All
GMC	Sierra	2019 - 2021	All	All	2.7L (L3B)	All

Involved Region or Country	North America
	Potential engine damage while servicing the Crankshaft Balancer and/or cam drive system related components
K alise	Crankshaft sprocket may disengage from crankshaft while servicing the crankshaft balancer and/or cam drive system related components


Caution: Do not rotate the crankshaft on these engines with the crankshaft balancer removed. The crankshaft balancer and bolt must be reinstalled to avoid damage to the crankshaft sprocket, crankshaft and valvetrain.

Caution: When servicing any cam drive system components that require crankshaft balancer removal, the appropriate Flywheel Lock / Alignment and Camshaft Alignment Tools for the engine application must be installed to avoid engine valvetrain damage.


As shown below, the crankshaft sprocket is separate from the crankshaft and held in proper position by the crankshaft balancer and Bolt.

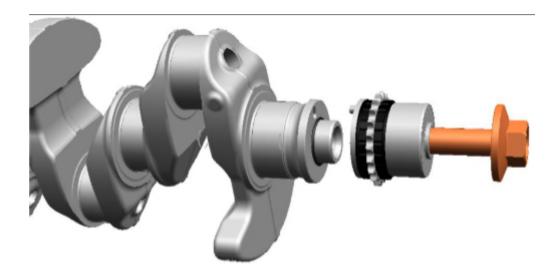

Anytime that the crankshaft balancer (1) is removed for service, install the crankshaft balancer bolt by hand to maintain the crankshaft sprocket (2) to the crankshaft.

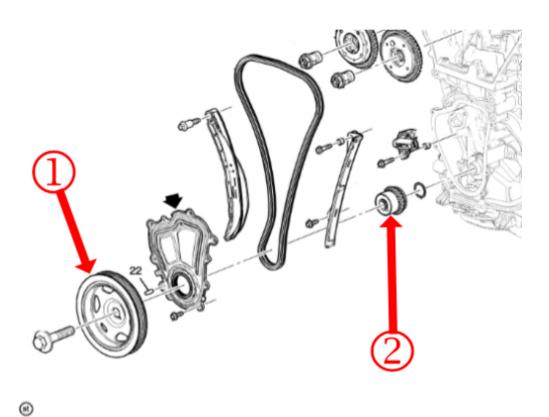

Crankshaft Balancer Bolt installed to maintain Sprocket to Crankshaft relationship

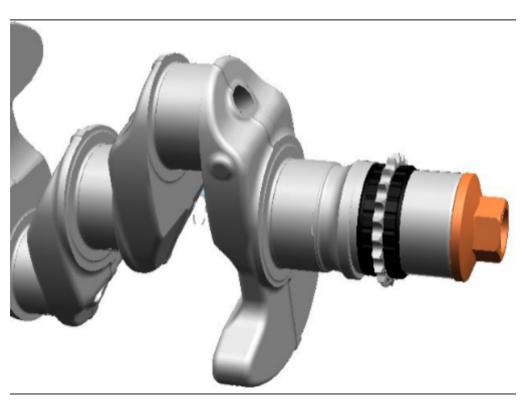

Version	3
Modified	03/03/2020 - Created on. 03/09/2021 - Updated to add models and years. 03/23/2021 - Updated to add to service procedure information.



GENERAL MOTORS

 $\ensuremath{\mathbb{C}}$ 2021 General Motors. All Rights Reserved.