	ΓΟΥΟΤΑ	Tech Tip	T-TT-0616-20	March 22, 2021			
Subject Market Steering Recalibration After Abnormal Steering USA Sensation or Battery Disconnect USA							
Service Cate Steeri	ng		Section Power Assist Sy	stems			
Applicability 2019-2	2021 RAV4 and RA	V4 HV					
APPLICABLE VEHICLES							
	-2021	RAV4	2019-2021	RAV4 HV			
COND	ITION						
Some customers may experience an abnormal steering sensation ("pulling", "drifting"), which may be more pronounced after a cold soak.							
The steering angle value displayed in Techstream may be greater than <u>+</u> 3° off when the steering wheel is held straight.							
Every time the vehicle's battery is disconnected or discharged, the Steering Angle Neutral Point Memorization and the Steering Sensor Zero Point Calibration must be performed.							
These steps are consistent with Step 3 and 4 of the "BEFORE INSPECTION" section of the Pre- Delivery Service Check Sheet (Link Below).							
RECO	MMENDATIONS						
1. Check for DTCs – if found, proceed with the repair recommended in the Repair Manual.							
2.	If no DTCs are found; disconnect the battery, wait 30 minutes and reconnect the battery.						
3.	 3. As per the Pre-Delivery Service Check Sheet, proceed with the Repair Manual process for memorizing the Steering Angle Neutral Point described in RM100000001FAJ7 (Link Below): Memorizing the Steering Angle Neutral Point includes: Fully turning the steering wheel lock-to-lock on level ground. 						
4.	 After memorizing the Steering Angle Neutral Point (above), complete the Repair Man process for Steering Sensor Zero Point Calibration described in RM100000001FOLC Below): 						
	 Steering Set For Gas 	Models: Driving	Calibration Sequence incluvehicle straight at speed (rehicle straight at speed (>	>10 mph for >1 second)			
5.	After performing both calibration sequences described above, confirm that the abnormal steering sensation has been corrected.						
6.	lf abnormal operati	on continues, co	ntact TAS.				
Expires	on 03/22/2022 Re	v1 © 202	0, Toyota Motor Sales, USA	Page 1 of			

Ver. 2.12 01/01/2020 T

ΤΟΥΟΤ	Tech Tip	T-TT-0616-20	March 22, 2021				
SubjectMarketSteering Recalibration After Abnormal SteeringUSASensation or Battery DisconnectUSA							
Applicability							
LINK REFERENCES							
 <u>2020 RAV4, RAV4 HV Pre-Delivery Service (PDS) Check Sheet</u> <u>PRE-COLLISION: PRE-COLLISION SYSTEM: INITIALIZATION; 2019 - 2020 MY</u> <u>RAV4 RAV4 HV [11/2018 - ??????</u>] 							

3. PARK ASSIST / MONITORING: PARKING ASSIST MONITOR SYSTEM: INITIALIZATION; 2019 - 2020 MY RAV4 RAV4 HV [11/2018 - ??????]