



**NUMBER:** 21-013-21

**GROUP:** 21 - Transmission and Transfer Case

**DATE:** March 30, 2021

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**SUBJECT:**

Flash: Transmission Control Module (TCM) Updates

**OVERVIEW:**

This bulletin involves reprogramming the TCM with the latest available software.

**MODELS:**

2021 (JT) Jeep Gladiator

**NOTE:** This bulletin applies to vehicles within the following markets/countries: North America and EMEA.

**NOTE:** This bulletin applies to vehicles built on or before January 19, 2021 (MDH 0119XX), equipped with a 3.0L V6 Turbo Diesel Engine W/ESS G3 (Sales Code EXJ) and 8-Speed Automatic 8HP75 Transmission (Sales Code DFV).

**SYMPTOM/CONDITION:**

Customers may experience the following on a vehicle with less than 64 km (40 miles) on the odometer:

- A Malfunction Indicator Lamp (MIL) event or failure with **no** Diagnostic Trouble Codes (DTCs) and the vehicle has less than 40 miles on the odometer indicates it is likely the vehicle has experienced an unintentional code clear event.

**NOTE:** Do not use this software update if vehicle odometer has over 64 km (40 miles).

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If symptom conditions, other than the ones listed are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above, perform the Repair Procedure.

**REPAIR PROCEDURE:**

**NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Reprogram the TCM with the latest available software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
2. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
18-19-05-PU	Module, Transmission Control (TCM) - Reprogram (0 - Introduction)	2 - Automatic Transmission	0.2 Hrs.

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 4 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

**FAILURE CODE:**

**The dealer must use failure code CC with this Service Bulletin.**

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- When utilizing this failure code the 3C's (customer's concern, cause and correction) must be provided for processing Service Bulletin flash/reprogramming conditions.

CC	Customer Concern
----	------------------