



Parts Bulletin

TITLE:

**Service Action S10083: Rear Wiper Fuse
Model Year XC40 Recharge 2021**

**GROUP:
37**

**CAT/NO:
S10083**

**CAR MARKET:
United States and Canada**

REVISIONS:

**ISSUE DATE:
2021-03-12**

**STATUS DATE:
2021-03-12**

Page 1 of 1

“Right first time in Time”

Reference Bulletins: QB S10083

Volvo Car USA LLC and Volvo Car Canada Ltd on behalf of Volvo Car Corporation, has decided to launch Service Action S10083 on certain Volvo XC40 Recharge Model Year 2021 vehicles.

Volvo has identified that the rear wiper motor is protected by a 5 ampere (A) fuse instead of a 15A fuse in the central junction box. There is a risk that the 5A fuse may blow prematurely if wiper system is put under stress, for instance when a rear wiper is blocked due to ice or snow build up. In a worst-case scenario, the fuse will blow, and the rear wiper will not function. No DTC’s or DIM messages will be set if the fuse is blown.

The corrective action is to replace the incorrect 5A fuse with a 15A fuse.

S10083 affects 432 vehicles in the U.S. and 41 in Canada.

The following part number applies:

Part Number	Description	Qty
31346548	Fuse	1