

2021 Ascent

1) UNIT SOLD. ISSUE FOUND ON PDI FOR SALE. HAVING TO PUSH OFF DELIVERY OF UNIT TILL ISSUE RESOLVED. WATER HEATER AND FURNACE INOP/INTERMITTENT. FOUND W/H INOP AND FURNACE INTERMITTENTLY RUNNING NOT CYCLING TO SPECIFIED TEMP. VERIFY LP FILL, VERIFY DC VOLTAGE AT W/H BOARD, VERIFY VOLTAGE TO GAS VALVE DURING HOT WATER FLOW. LOCK UP PRESSURE =OK AT 11"WC, ACCESS AND DISCONNECT LP LINE AT BACK OF W/H. VERIFY GAS PRESSURE OK AT 11"WC. CONNECT AUS LP SUPPLY DIRECT TO W/H CHECKED GOOD W/ AUX SUPPLY. ACCESS AND REMOVE REGULATOR CONNECT AUX LP SUPPLY, VERIFY W/H AND FURNACE OPERATE. REINSTALL REGULATOR APPLY LP TO INLET SIDE VERIFY OPERATION, CHECKS GOOD. SUSPECT BAD ELECTRIC GAS SOLENOID IN TANK. NEED TO DISCONNECT ALL P LINES, UNBOLT MOUNT, R/R LP CYLINDER COMPLETE, REFILL NEW, VERIFY ALL LP APPLIANCES AND MANO TEST. 4.0HRS 3.0 approved maximum. We will send a solenoid under warranty as one time. You need to get parts from Manchester Tanks as I explained to Greg.